

NO. OF COPIES RECEIVED		
DISTRIBUTION		
VITA FE		
ICE		
S.G.S.		
AND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO REOPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT - (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☒ OTHER ☐

Name of Operator
Hamon Operating Company (Ph:915-699-4987)

Address of Operator
3525 Andrews Highway Suite 105A Midland, Texas 79703-4987

Location of Well
UNIT LETTER **D** **660** FEET FROM THE **West** LINE AND **660** FEET FROM
North LINE, SECTION **20** TOWNSHIP **20S** RANGE **36E** N.M.P.M.

15. Elevation (Show whether DF, RT, CR, etc.)
3644' KB

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
E-8913

7. Unit Agreement Name

8. Farm or Lease Name
State E-8913 Com

9. Well No.
1

10. Field and Pool, or Wildcat
Osudo North Morrow

12. County
Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

REFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
IMPROVINGLY ABANDON ☐	CHARGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
ILL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Attempt to pump into formation w/Baker Model D in place; 300 lb. Pull out Model D and spot 25 sack plug @ 11,200'.
2. Circulate hole with mud.
3. Set 35 sack plug @ 10,829'.
4. Set 35 sack plug @ 10,267'.
5. Set 35 sack plug @ 7,384'.
6. Displace all plugs with mud laden fluid.
7. Cut and pull 5 1/2" casing @ 5,268'.
8. Set 150 sack plug @ 5350', tag plug @ 5015'.
9. Set 75 sack plug @ 3370'.
10. Set 75 sack plug @ 1960'.
11. Cut casing (9 5/8") @ 389' and pull.
12. Set 150 sack plug @ 430'.
13. Set 10 sack plug @ surface.
14. Cut off wellhead.
15. Install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Guy A. Baber / KH TITLE President DATE 4-17-86

APPROVED BY R. A. [Signature] TITLE OIL & GAS INSPECTOR DATE 4-17-86

CONDITIONS OF APPROVAL, IF ANY:

PA posted E

RECEIVED
APR 18 1986
HOBBS OFFICE