

COPIES RECEIVED		
DISTRIBUTION		
DATE		
BY		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - A" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Martindale Petroleum Co.	8. Farm or Lease Name Selman
3. Address of Operator Box 1955 Hobbs, New Mexico 88240	9. Well No. 1
4. Location of Well UNIT LETTER M , 990 FEET FROM THE South LINE AND 330 FEET FROM THE West LINE, SECTION 11 TOWNSHIP 19 S RANGE 38 E N.M.P.M.	10. Field and Pool, or Wildcat Undesignated
15. Elevation (Show whether DF, RT, GR, etc.) 3614 DF	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- MIRU Casing pulling rig. Run and set CIBP A 4150'. Cap BP with 4 sx. cement.
- Free point 5 1/2" casing. Cut 5 1/2" @ approx. 2500 ft.
- Break Circulation w/ MLF thru 5 1/2". Spot ⁵⁰ 40 sx. cement plug on top of 5 1/2" stub.
- Spot 100 ft. cmt. plug top of salt. ⁵⁰ 40 sx. 1925 to 1825 - P.O.H.W 5 1/2
- Run tubing and spot 50 sx. cmt. plug 50' out and 50' inside 8-5/8" (298'-398')
- Spot 10 sx. cmt. plug in top of 8-5/8" @ surface.
- Install dry hole marker and clean location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u><i>Robert J. Anderson</i></u>	TITLE <u>President</u>	DATE <u>6-3-74</u>
APPROVED BY <u><i>[Signature]</i></u>	TITLE <u></u>	DATE <u></u>

CONDITIONS OF APPROVAL, IF ANY: