

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY  
N. M. OIL & GAS  
P. O. BOX 1800  
HOBBS, NEW MEXICO 88240  
SUBMIT IN TRIPlicate  
On Other Instructions  
verse sideForm approved  
Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.

LC 065649

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> Water Injection Well		7. UNIT AGREEMENT NAME South Pearl Queen	
2. NAME OF OPERATOR Tamarack Petroleum Company, Inc.		8. FARM OR LEASE NAME South Pearl Queen Unit	
3. ADDRESS OF OPERATOR P. O. BOX 2046, Midland, TX 79702		9. WELL NO. 26	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface  1988 FWL & 1194.4 FNL, Section 9, T20S, R35E		10. FIELD AND POOL, OR WILDCAT Pearl Queen	
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 9-20S-35E	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3701.9DF		12. COUNTY OR PARISH Lea	13. STATE New Mexico

## 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON\* ☐CHANGE PLANS ☐

## SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT\* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

## PLUG AND ABANDON NO LONGER NECESSARY WATER INJECTION WELL

1. Move in and rig up plugging unit July 30, 1985
2. Unset Baker AD-1 tension Packer and pull out of hole on July 31, 1985.
3. Set CIBP at 4940' (Perfs 5027 - 35'), Pump 5 sacks cement on plug.
4. Run in hole with 2 3/8" tubing and circulate with 9.5# mud.
5. 4 1/2" casing free to 2100'. Run in hole with tubing to 3686' and pump 20 sacks cement. Pull out of hole.
6. Cut 4 1/2" casing at 2003' and pull out and lay down.
7. Pump 40 sacks cement from 2104. Run in hole w/ tubing Aug 1 1985 and tag plug @ 1914'.
8. Pump 40 sacks cement from 260 (B/8 5/8" CSG @ 214') wait on cement 3 hours and tag plug at 157'.
9. Set 10 sacks cement surface plug and marker Aug 2, 1985.
10. Clean location.

18. I hereby certify that the foregoing is true and correct.

SIGNED

*Randy A. McClay*

TITLE

Engineering Manager

DATE

8/7/85

(This space for Federal or State official use)

APPROVED BY

TITLE

DATE

10-2-86

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side