

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-73

5a. Indicate Type of Lease  
State ☒ Fee ☐  
5. State Oil & Gas Lease No.

<p><b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p>		
<p>1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/></p>		7. Unit Agreement Name
<p>2. Name of Operator AMOCO PRODUCTION COMPANY</p>		8. Farm or Lease Name South Hobbs/GSA/ Unit
<p>3. Address of Operator P. O. Box 68, Hobbs, NM 88240</p>		9. Well No. 122
<p>4. Location of Well SL/BHL UNIT LETTER H/E 1726/1381 FEET FROM THE North LINE AND 167/39 FEET FROM THE East LINE, SECTION 4/3 TOWNSHIP 19-S RANGE 38-E NMPM.</p>		10. Field and Pool, or Wildcat Hobbs GSA
<p>15. Elevation (Show whether DF, RT, GR, etc.) 3625' KB</p>		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOBS ☐  
OTHER ☐

ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MI and RUSU 2-27-87. Load pump and rods. RIH with 5-1/2" casing scraper to 4200 ft. POH and set CIBP on wireline to 4108. Run 5-1/2" cement retainer and set at 3976. Pump 50 sx class C, 3% HaladG, 100 sx class C 3# stuff plug. Reverse out 47 sx. POH tubing stringer.. Run 4-3/4" bit, 8 3-1/2" drill collars to 3300 ft. Tag cement 3971. Drill retainer at 3976. Drill cement to 4059. Stringer to 4108. Drill CIBP, 4108 push to 4288. Drill to 4289. POH and load drill collars. Run ESP. RD and MOSU 3-4-87.

PPWO: 107 BOPD, 965 BWPD, 93 MCFD.  
PAWO: 147 BOPD, 850 BWPD, 21 MCFD.

I, the undersigned, hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed Steve D. Brownlee

TITLE Admin. Analyst

DATE 3-25-87

ORIGINAL SIGNED BY JERRY SEXTON

DISTRICT I SUPERVISOR

TITLE

DATE

MAR 27 1987

CONDITIONS OF APPROVAL, IF ANY: