

CONSERVATION DIVISION

P. O. BOX 2086  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State ☐ ☒ ☐  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Alpha Twenty-One Production Company		8. Farm or Lease Name Toni
3. Address of Operator P.O. Box 1206, Jal, NM 88252		9. Well No. 2
4. Location of Well UNIT LETTER <u>I</u> <u>2310</u> FEET FROM THE <u>South</u> LINE AND <u>480</u> FEET FROM THE <u>East</u> LINE, SECTION <u>22</u> TOWNSHIP <u>19S</u> RANGE <u>38E</u> <u>S. 10 E. 1</u> Hobbs Grayburg SA		10. Field and Pool, or VBL, or
11. Elevation (Show whether DF, RT, GR, etc.) 3599' GL		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

5-28-85 Rigged unit up and installed BOP. Pulled and tallied tubing. RIH with CIBP and set @ 4050'.

5-29-85 RIH with tubing to tag CIBP and circulate hole with brine water and salt gel. Pumped 5 sx plug on top of CIBP. Set plugs as follows:  
25 sx plug at 2726' - 2474'  
Perforate 5-1/2" casing with 4 shots @ 1750', set retainer on wireline @ 1500', and squeeze 100' cement under retainer.  
Perforate 5-1/2" casing with 4 shots @ 350', circulate 80 sx behind 5-1/2" casing.

5-30-85 Erected dry hole marker, cleaned location of surface equipment, cut off anchors, and filled in cellar.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED R. W. Langford TITLE VP/Energy Resources DATE 6-19-85  
APPROVED BY R. W. Langford TITLE OIL & GAS INSPECTOR DATE JUL 26 1985

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JUN 25 1985

O.C.D.  
HOBBS