

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-30543
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	
Snyder-State	
8. Well No.	1
9. Pool name or Wildcat	West Teas-Yates/SR
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
3550' GR	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL ☐ GAS WELL ☐ OTHER Dry Hole
2. Name of Operator	Olsen Energy Inc.
3. Address of Operator	16414 San Pedro, Suite 470, San Antonio, Tx 78232
4. Well Location	Unit Letter H : 660 Feet From The East Line and 1980 Feet From The North Line
Section	16
Township	20-S
Range	33-E
NMPM	Lea
County	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-2-89 Log at 3429' TD

3-3-89 Run drill pipe to TD. R.U. Western. Pump 148 Sxs Class "H" w/2% CaCl₂ P.U. to 2933'. Circ. and W.O.C. 4 hrs. G.I.H. to 3057'. Did not tag cement. P.U. and circ. 2 hrs. G.I.H. Tag cement at 3271' (240' low). Pump 10 sxs Class "H" w/2% CaCl₂ & 195 sxs Class "H" w/18% salt. P.U. and W.O.C. 4 hrs. Tag cement at 2718'. Pump 195 sxs. Class "H" w/18% salt. P.U. to 2132'. Pump 195 sxs Class "H" w/18% salt. Pull up to 1576'. Pump 195 sxs Class "H" w/18% salt. Pull out of hole. W.O.C. 6 hrs. Tag cement at 801'. Lay down drill pipe. Put 10 sxs plug at surface. Cut off casing. Weld on plate and install dry hole marker.

6-12 &

6-26-89 Back-fill pits. Level and clean location. Ready for inspection.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Dick Morton TITLE Drlg. & Prod. Mgr. DATE 7-12-89
TYPE OR PRINT NAME Dick Morton TELEPHONE NO. 512/496-2466

(This space for State Use)

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE AUG 18 1989
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

JUL 14 1989

OCD
HOBBS OFFICE