

State A-2A #6

30-025-30946

Recommendation to Temp. Abandon

This well is currently inactive. It is recommended that the well be temporarily abandoned in order to evaluate possible up-hole potential.

1. POOH with rods, release tubing anchor and POOH tubing w/tubing anchor.
2. Make scraper run inside 7", 23# casing to top perf of 5314'.
3. Set Cast Iron Bridge Plug w/in 50' of top perf @ 5264', spot 35' cmt on top of CIBP.
4. Circulate Casing with inhibited packer fluid.
1. Pressure test casing to 500# for 30 minutes. Give OCD 24 hrs notice prior to pressure test.