

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL / PI NO. 30 025 31727	
5. Indicate Type of Lease STATE ☒ FEE ☐	
6. State Oil / Gas Lease No. TG-314694	
7. Lease Name or Unit Agreement Name VAN ETEN, L.	
8. Well No. 13	9. Pool Name or Wildcat MONUMENT, ABO, SOUTHEAST

SUNDY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>K</u> : <u>1653</u> Feet From The <u>SOUTH</u> Line and <u>2307</u> Feet From The <u>WEST</u> Line Section <u>9</u> Township <u>20-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3541' GR

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1-20-98: MIRU. TIH W/CMT RET ON 2 7/8" TBG. SET RET @ 5494'. TEST TBG TO 3000 PSI-OK. SQUEEZE E LINEBRY PERFS 5598-5786' W/50 SX CL C. DUMP 1 BBL CMT ON TOP OF RET. REV TBG.
1-05-98: RAN BIT & DC'S ON TBG. TAG @ 5494'. DRILL RET FR 5494-5495'.
1-06-98: RAN CMT RET & SET @ 5521'. PUMPED INTO BLINEBRY PERFS 5598-5787 W/75 SX CL C. PUMPE D ADD'L 75 SX CL C
1-08-98: RAN BIT & DC'S TO 5520'. CMT RET FR 5520-5521'. LOST CIRC. JNK TO 5620'. PLUG BIT.
1-09-98: RAN CMT RET ON TBG. SET RET @ 5460'. SQUEEZED 5598-5622' W/50 BBLS 9.2# BRINE, 3 BFW. REV 16 BBLS CMT.
1-12-98: TIH W/NEW BIT, DC'S ON TBG. CMT @ 5420'. DRLD HARD CMT TO 5460'.
1-13-98: DRLD CMT FR 5609-5622'. PRESS TEST CSG TO 550 PSI. LK'D OFF TO 0 PSI.
1-14-98: RAN 2 7/8" TBG TO 5795'. MIX & SPOT 25 SX CL C NEAT CMT OVER PERFS.
1-16-98: RAN BIT & DC'S ON TBG.
1-17-98: C/O FILL FR 6235-6281'. RAN PKR & SET @ 5797'. TEST CIBP TO 2000 PSI.
1-18-98: PSA 5688'. TEST RBP TO 2000#-OK. RESET PKR @ 5524'. REL RBP & RESET ABOVE PERFS.
1-19-98: RAN BIT & DC'S. DRILL OUT FRAC BALLS FR 6281'-6300'.
1-20-98: DRLD CIBP 6300-6302'. C/O TO 7466'. (NEW PBTD)
1-21-98: TIH W/CSG INSPECTION LOG. LOG FR 7448-5000.
1-22-98: PERF MONUMENT ABO ZONE 7028-7244'. RAN PKR ON TBG & SET @ 6979'.
1-23-98: ACIDIZED PERFS 7028-7244' W/6000 GALS 15% NEFE. LEFT FLOWING TO BTRY ON 18/64" CHOKE @ 1600 PSI.
1-28-98: SET PLUG IN PROFILE NIPPLE @ 6979'. RAN RBP & PKR. SET RBP @ 6712'. PSA 6700'.
1-29-98: RAN CMT RET ON TBG TO 6255'.
1-30-98: SET RET @ 6255'. SQUEEZED 6327-6546' W/150 SX CL C. PULL TBG TO 5850'. SPOT 29 SX MICROFINE CMT OVER PERFS.
2-02-98: TIH W/BIT & DC'S ON TBG. DRLD CMT
2-04-98: RAN RETR TOOL ON TBG. TAG @ 6635'. RBP @ 6695'.
2-08-98: RAN RDS. RAN ON-OFF TOOL ON TBG. PSA 6979'. REM BOP. SWABBING & FLOWING. RAN PROD LOG 7028-7244'. HU PLUNGER LIFT EQPT. ON PLUNGER LIFT 2-17-98.
2-23-98: MIRU PU. INSTL BOP & REL PKR.

(OVER)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 6/10/98
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED BY _____ TITLE DISTRICT I SUPERVISOR DATE 6/10/98
CONDITIONS OF APPROVAL, IF ANY: