Submit 3 Copies To Appropriate District Office		State of New Mexico nergy, Minerals and Natural Resources		Form C-103 Revised March 25, 1999	
District I 1625 N. French Dr., Hobbs, NM 87240 District II 811 South First, Artesia, NM 87210 District III 1000 Rio Brazos Rd., Aztec, NM 87410 District IV	OIL CONSERVATION OIL CONSERVATION OF THE PROPERTY OF THE PROPE	OIL CONSERVATION DIVISION 2040 South Pacheco Santa Fe, NM 87505		WELL API NO. 30-025-32772 32/22 5. Indicate Type of Lease STATE X FEE	
SUNDRY NOTICE (DO NOT USE THIS FORM FOR PROPOS DIFFERENT RESERVOIR. USE "APPLICA PROPOSALS.) 1. Type of Well: Oil Well Gas Well X 2. Name of Operator OXY USA WTP Limited Partnersh 3. Address of Operator P.O. Box 50250 Midland, TX 4. Well Location	TION FOR PERMIT" (FORM C-Other) 79710-0250	N OR PLUG BACK TO A	6. State Oil & Gar 7. Lease Name or State E 8. Well No. 6 9. Pool name or W Eumont Yates 7	Vildcat Rvrs Qn (PG)	
Section 30	Township 19S 10. Elevation (Show whether	Range 37E er DR. RKB. RT. GR. et	NMPM	County Lea	
NOTICE OF INTER	PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Operations (Clearly state all EE RULE 1103. For Multip of the Well Bore.	SUB REMEDIAL WORK COMMENCE DRILLI CASING TEST AND CEMENT JOB OTHER:	SEQUENT REF	PORT OF: ALTERING CASING PLUG AND ABANDONMENT Including estimated date	
	See Other Side				
hereby certify that the information above is	true and complete to the best of	of my knowledge and belief			
SIGNATURE MANAGEMENT	TII	TLE Sr. Regulatory A	Analyst r	DATE (2/01/02	
Type or print name David Stewart			Telepho	ne No. 915-685-5717	
This space for State use) APPROVED BY Conditions of approval, if any:	OF DISAM SKRAM	EENTATIVE HISTAFE N	ANACEE DA	DEC 1 3 2002	

STATE E #6

11/20/2002 CMIC: gary henrich

test tie down anchors, miru key pulling unit #293, hold safety meeting, spot & rig up, sitp 100#, sicp 100#, bleed both down, nd wh, nu 3k manual bop, attempt to work tbg. free w/no success, ru hot oiler, pump 15 bbls. fresh water down csg., hot water tbg. w/21bw, try to work tbg. free w/no success, ru rotary wl, rih w/free point tools, tbg. 100% stuck @ 3350', tbg. free above 3319', pooh, rih w/chemical cutter & cut tbg. @ 3318', pooh, rd wl, pooh w/105 jts. 2-3/8" j-55 tbg. & cut jt., sisd!

11/21/2002 CMIC: gary henrich

rih w/ 4-3/4"bit, 5.5"csg.scraper & 106 jts. 2 3/8" tbg., tag up @ 3318', pooh, ru baker atlas wl, rih w/5.5" cibp, tag up 3234', try to work deeper w/no success, pooh, rd wl, rih w/5.5" cibp on 2-3/8" tbg., set cibp @ 3310', ru haliburton cmt. trucks, mix & pump 25 sx class c cmt. (3310'- 3063') pu to 2602', mix & pump 25 sx c neat (2602'- 2355') pu to 1254', m & p 25 sx c neat (1254'- 1007'), pu to 490', m & p 50 sx c neat & circ. cmt. to surface, pooh, nd bop, fill csg. to top w/ cmt., rd haliburton, sd!

11/22/2002 CMIC: gary henrich

rig unit down, clean loc., move off loc.