

ORYX ENERGY COMPANY  
ONSHORE USA

MAVEETY-WEIR UNIT# 10

On 5-1/2" casing, precede cement with 20 BFW. Run top and btm plugs. Displace top plug with fresh water. Bump plug to 500 psi over final pressure. Actual cement volumes will be adjusted according to caliper log + 30% Run temperature survey 10-12 hrs after job is complete. Recipocate pipe prior to and during cement job.

Notify New Mexico Conservation Comm. 24 hours prior to cementing casing strings

Pilot test all slurries with field mix water prior to pumping.

ENVIRONMENTAL: Collect all trash from the location for proper disposal. Use Oil Center Reseach Liquid-O-Ring 318 lead free compand to dope all casing strings and fence the reserve pit on the three sides away from the rig to protect individual and wildlife.

DRILLING TIME:

Activity	Depth	Days	Bits
Drlg out days	500'	1	1
TD	3700'	5	2
Prod Csg/RR	3700'	6	2

Prepared by \_\_\_\_\_ Date \_\_\_\_\_  
Bill Lewis

Approved by \_\_\_\_\_ Date \_\_\_\_\_  
Steve Linke

**RECEIVED**

DEC 10 1994

COO HOBBS  
OFFICE