MIRU SCHLUMBERGER & PERF. FROM

3046'-56'.3060'-68'.3072-78'.3108'-08',3134'-44',3164'-70',3298'-3301',3328'-44',3357'-60' W/ 6 SPF FOR TOTAL 402 SHOTS. RD SCHLUMBERGER. PUMP 7 BBLS INTO CASING TO FILL. DISPLACE 400 GAS. ACID INTO PERFS @ 2 BPM. MAX PRESS. 2000#, MIN. PRESS. 1700#, ISIP 1700#. CI. OPEN WELL & BLED DWN PRESS. TIH W/2-7/8" TBG. TOH LAYING DWN TBG. REMOVE BOP & INSTALL FRAC VALVE. RDMO DAWSON WELL SVC. CLEAN LOC. CI. WAITING ON FRAC EQUIP. PREPARING TO FRAC. MIRU HALLIBURTON FRAC SVC. & FRAC EUMONT PERFS W/68300 GALS. OF MY-T-GEL XL GUAR FOAM, 250000# OF 12-20 BRADY SAND. FLUSH W/100% CO2 TO TOP PERF. FLOWING. WELL FLOWED 574 MCFPD & 30 BW. CASING PRESS. 120 PSI. (MIRU DAWSON WELL SVC. RU TRI-CONE AIR EQUIP. MOVE 2-7/8" TBG & SET UP ON RACKS. HOOK UP BLOW DWN LINES & START BLOWING DWN TO PIT & BLOW DWN TANK. WIND BLOWING GAS ACROSS RIG. CLOSE BLOW DWN LINES. PUMP 20 BBLS WTR DWN CASING. REMOVE FRAC VALVE & INSTALL BOP. FLOWING. OPEN WELL & BLOW PRESSURE TO PIT. PU & TIH W/4'SUB W/2-7/8" NOTCH COLLAR, HALLIBURTON N. NIPPLE.17 JTS 2-7/8" IOV TBG. WELL STARTED FLOWING OUT TBG. WAIT ON HALLIBURTON PLUG. PUMP 5 BBLS 2% KCL W/LO-SURF 300 DWN TBG. DROPPED PLUG DWN TBG. FINISHED TOH W/2-7/8" TBG TO 3328' TAGGED SAND. RU TRI-CONE & POWER SWIVEL. CLEAN OUT SAND FROM 3328' TO 3410'. CIRC. HOLE CLEAN, DROPPED 4 SOAP SWEEPS. CI. LEFT FLOWING OUT OF CASING. OPEN WELL. TIH & TAGGED PLUG @3410'. PULL TBG TO 3314'. REMOVED BOP & LAND TBG AT 3314'. NIPPLE UP WELLHEAD. RU JARRELL WIRELINE & FISH HALLIBURTON PLUG. RD JARRELL. START WELL FLOWING DWN SALES LINE. FLOW RATE @ 1033 MCF. TBG PRESSURE 90#. CSG PRESS 360#. RDMO DAWSON WELL SVC. CLEANED LOCATION. FLOWING.