

CON'T - WEIR GC #9 - PAGE 2

MIRU SCHLUMBERGER & PERF. FROM

3046'-56', 3060'-68', 3072'-78', 3108'-08', 3134'-44', 3164'-70', 3298'-3301', 3328'-44', 3357'-60' W/
6 SPF FOR TOTAL 402 SHOTS. RD SCHLUMBERGER. PUMP 7 BBLS INTO CASING TO FILL. DISPLACE 400 GAS.
ACID INTO PERFS @ 2 BPM. MAX PRESS. 2000#, MIN. PRESS. 1700#, ISIP 1700#. CI. OPEN WELL & BLED
DWN PRESS. TIH W/2-7/8" TBG. TOH LAYING DWN TBG. REMOVE BOP & INSTALL FRAC VALVE. RDMO DAWSON
WELL SVC. CLEAN LOC. CI. WAITING ON FRAC EQUIP. PREPARING TO FRAC. MIRU HALLIBURTON FRAC SVC.
& FRAC EUMONT PERFS W/68300 GALS. OF MY-T-GEL XL GUAR FOAM, 250000# OF 12-20 BRADY SAND.
FLUSH W/100% CO2 TO TOP PERF. FLOWING. WELL FLOWED 574 MCFPD & 30 BW. CASING PRESS. 120 PSI.
(MIRU DAWSON WELL SVC. RU TRI-CONE AIR EQUIP. MOVE 2-7/8" TBG & SET UP ON RACKS. HOOK UP BLOW
DWN LINES & START BLOWING DWN TO PIT & BLOW DWN TANK. WIND BLOWING GAS ACROSS RIG. CLOSE BLOW
DWN LINES. PUMP 20 BBLS WTR DWN CASING. REMOVE FRAC VALVE & INSTALL BOP. FLOWING. OPEN WELL &
BLOW PRESSURE TO PIT. PU & TIH W/4'SUB W/2-7/8" NOTCH COLLAR, HALLIBURTON N. NIPPLE, 17 JTS
2-7/8" IOV TBG. WELL STARTED FLOWING OUT TBG. WAIT ON HALLIBURTON PLUG. PUMP 5 BBLS 2% KCL
W/LO-SURF 300 DWN TBG, DROPPED PLUG DWN TBG. FINISHED TOH W/2-7/8" TBG TO 3328' TAGGED SAND.
RU TRI-CONE & POWER SWIVEL. CLEAN OUT SAND FROM 3328' TO 3410'. CIRC. HOLE CLEAN, DROPPED 4
SOAP SWEEPS. CI. LEFT FLOWING OUT OF CASING. OPEN WELL. TIH & TAGGED PLUG @3410'. PULL TBG TO
3314'. REMOVED BOP & LAND TBG AT 3314'. NIPPLE UP WELLHEAD. RU JARRELL WIRELINE & FISH
HALLIBURTON PLUG. RD JARRELL. START WELL FLOWING DWN SALES LINE. FLOW RATE @ 1033 MCF. TBG
PRESSURE 90#. CSG PRESS 360#. RDMO DAWSON WELL SVC. CLEANED LOCATION. FLOWING.