

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

OIL CONSERVATION DIVISION

DISTRICT I

P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

2040 Pacheco St.  
Santa Fe, NM 87505

WELL API NO.

30-025-33780

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL  
WELL ☒

GAS  
WELL ☐

OTHER

2. Name of Operator

ARCO Permian

3. Address of Operator

P.O. Box 1089 Eunice, NM 88231

8. Well No.

1

9. Pool name or Wildcat

Devonian (Wildcat)

4. Well Location

Unit Letter P 467 Feet From The S Line and 990 Feet From The E Line

Section 30 Township 19S Range 30E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3607' GR

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

05/28/98: MIRU. POH w/rods & pmp. NDWH. NUBOP. NMOCD notified of plugging operations  
05/27/00 per Sylvia.

05/29/98: POH w/tbg & prod. equip. Set CIBP @ 8600'. Dump 35' cmt on top of CIBP. NDBOP  
& WH. PU and cut 5-1/2" csg off @ 6000'. NUBOP.

05/30/98: POH & lay down 5000' 5-1/2" csg. RIH w/2-7/8" tbg to 6046'.

05/31/98: Displace hole w/mud. Spot 30 sxs cmt plug @ 6046-5940'. Could not move tbg.  
Rev circ cmt to pit. Ran Free Point tool. Could not get past 5060'. Tbg free  
@ this point. Spot 50 sxs cmt plug @ 6046-5860'. Cut tbg off @ 5046'. Pull  
tbg up to 3786'. All steps approved by Buddy Hill of Hobbs NMOCD. Left 31-3/4  
jts 2-7/8" tbg in hole 6046-5046'.

06/02/00: Run tbg OE to 4196'. Circ hole w/mud. Spot 30 sxw cmt plug @ 4196-4085'. WOC.  
Tag plug @ 4095'. PU & spot 30 sxs cmt plug @ 1665-1550'. PU & spot cmt plug @ (over)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE Sr. Administrative Assistant

DATE 09/26/00

TYPE OR PRINT NAME Kellie D. Murrish

TELEPHONE NO. 505-394-1649

(This space for State Use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

474-370'. Spot 10 sxs surf plug. Cut wellhead off & weld cap on. Well P&A'd.  
Plugging witnessed by Gary Wink, NMOCD.

