State of New Mexico Energy, Minerals & Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I PO Box 1980, Hobbs,NM 88241-1980 DISTRICT II PO Drawer DD, Artesia, NM 88211-0719	OIL CONSERVATION DIVISION PO Box 2088 Santa Fe, NM 87504-2088		WELL API NO. - 36 5 Indicate Type of Lea	39 925 3 4476 0-025-34364	
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Leas	STATE FEE se No.	
(DO NOT USE THIS FORM FOR PF TO A DIFFERENT RESI (FORM C-	CES AND REPORTS ON WE ROPOSALS TO DRILL OR TO DEE ERVOIR. USE "APPLICATION FOR 101) FOR SUCH PROPOSALS)	PEN OR PILIC BACK	7. Lease Name or Unit	23178 Agreement Name	
1. Type of Well: OIL GAS WELL WELL	OTHER		INDIANA "1	"	
2. Name of Operator SAHARA OPERATING COMPANY			8. Well No.	2	
Address of Operator P.O. Box 4130, Midland, Texas 79704 Well Location			9. Pool name or Wildcat Goodwin, Abo 23179		
Unit Letter Lot 2 : 744 Feet From The North Line and 1653 Feet From The East Line					
Section 1		Range 36 East her DF, RKB, RT, GR, etc.) 3744' KB		Lea County	
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:					
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	[] A	LTERING CASING	
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING			OPNS. 🔲 PI	LUG AND ABANDONMENT	
PULL OR ALTER CASING CASING TEST AND C		MENT JOB			
OTHER:		OTHER: Perform F	lug Back Test ng	\times	
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103					
0/27/99 MIRU PU. POH w/rods & pmp, ND WH, NU BOP, POH w/tbg. LD 42 joints pitted. SDON. 0/28/99 Ran bit & csg scraper to 7141'. POH. PU CIBP & TIH to 7124'. Set CIBP, LD 1 std & circ hole w/100 bbls 2% KCL, tested casing & plug to 1000# OK. POH, LD 17 jts.					
0/29/99 RU Computalog &	RU Computalog & perf 6566-86'; 6592-97'; 6602-17', 2 jspf. Ran 2 its TP, model "R" pkr. SN, 202 its the TI S 6547'				
1/1/99 Swab 25 bbls sulph	Swab dn well & started recovering sulphur water, no show of oil or gas. Swab 25 bbls sulphur water. No show of oil or gas. Catch sample for analysis. RU pump truck, could just roll in @ 2800#.				
Could not est rate. RD pmp truck. Rel pkr & POH, LD pkr, TIH w/tbg open ended to 6629'. RU BJ, spot 25 sx Ciass "C" cmt, pull 20 stds, SIW BOP, pump in 2 bbls and caught pressure, pressured to 1000#, bled to 900# in 30 min. SIW, SDON.					
1/3/99 ONSIP 800#. Bled	off, POH, PU bit & collars, TII	I tag cement, drill 30'	green cement, 110' l	hard cement, fell free, close bop	
& test csg to 1000# w/reverse pump f/30 min OK. TlH to CIBP, Drill out & push to 7430'. Pull 30 stds & SDON. Fin OOH & LD bit & collars. RIH w/production equip and put well back on production in Goodwin ABO. Job Complete. Unsuccessful attempt to establish wildcat production in Drinkard zone. Drinkard tested & plugged.					
I hereby certify that the information a over	is the and complete to the best of my k	nowledge and belief.			
SIGNATURE	13/5//	TITLE Pres	sident	DATE <u>11-16-99</u>	
TYPE OR PRINT NAME Robert N	McAlpine	31 m m m m	TELEPHONE NO. 1-9	915-697-0967	
	David Sagrava I. d. a. d. a. d. a. William	Al yl e		11 34 6 5 c	
	0(\$1) (30) 1 (30) 30) 1 (30) 1	TTTLE		NOV & L TIME	
CONDITIONS OF APPROVAL IF ANY		*****			

IC

- X let a Fortal Aug - Red Ar and CT