

DISTRICT I

O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30 025 34528
5. Indicate Type of Lease	STATE ☐ FEE ☐
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	VAN ETEN L.
8. Well No.	19
9. Pool Name or Wildcat	Monument Paddock/Weir Blinbry
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3544 GL

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter O : 467 Feet From The SOUTH Line and 1650 Feet From The EAST Line
Section 9 Township 20S Range 37E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3544 GL

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐ Recomplete in Blinbry/Paddock

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-03-99: MIRU. RUN CBL FR 6000-2200. UNLOAD & RACK TBG & RDS.
5-04-99: TIH W/CSG GUN. PERF BLINBRY FR 5528-36, 5558-64, 5614-26, 5682-86. TIH W/SONIC HAMMER TOOL, TP, PKR, & SN ON 2 7/8" TBG. LEFT TOOL @ 5533 & PKR @ 5310'.
5-05-99: WASH PERFS 5528-5686' W/183 BBLS 2% KCL. ACID WASH SAME PERFS W/22 BBLS 15% NEFE HCL. PSA 5310'. TP @ 5533'. LOAD & TEST BACKSIDE TO 500#-OK. ACIDIZE SAME PERFS W/2100 GALS 15% NEFE HCL. RU SWAB. FL @ 3600'.
5-06-99: FL @ 4300'. END FL @ 4900'. REL PKR. TIH W/OPSMA, SN, TBG & TAC ON 2 7/8" TBG. MA @ 5783'. SN @ 5753'. TAC @ 5433'. NDBOP & NUWH. TIH W/PMP. SNKR BARS, & RODS.
5-07-99: TIH W/RDS. LOAD & TEST. CHECK FOR PUMP ACTION. OK. RIG DOWN.
5-08/5-09/99: TESTING. WELL PUMPING OFF.
5-24-99: (recomplete in paddock) MIRU. NDWH. NUBOP. TIH W/CIBP & SET @ 5475'. TIH W/DUMP BAILER. DUMP 35' CMT ON CIBP. NEW PBTD @ 5440'.
5-25-99: TIH W/CSG GUN & PERF IN PADDOCK FORMATION FR 5158-66, 5182-86, 5204-16. TIH W/PKR, SN, ON TBG. PSA 54C1'. PRESS TEST CIBP TO 550#. RESET PKR @ 5433'. TEST TO 500#. REL PKR & LOWER TO 5440' & TAG CMT ON TOP OF PLUG. PULL UP & SET PKR ABOVE PERFS @ 5051'. TEST CSG & PKR TO 500#-30 MINS-OK. REL PKR & LOWER TO 5273'. JUST BELOW PERFS & SET. TEST CSG & PLUG TO 500#. LOST 300# IN 25 MINS. TIH W/2ND CIBP & SET @ 5382'. TIH W/BAILER & DUMP 35' CMT ON TOP OF CIBP. NEW PBTD @ 5347'.
5-26-99: TIH W/PKR, & SN ON TBG. PSA 5337'. TEST & CHART CIBP TO 550# FOR 30 MINS-LOST 40#-OK. REL PKR & RESET @ 5C83'. LOAD & TEST BACKSIDE TO 500#-OK. UNABLE TO BREAK DN FORM W/WTR. PRESS TO 2565#. OPEN BYPASS & SPOT ACID TO PKR. ACIDIZE PADDOCK PERFS 5188-5216' W/1000 GALS 15% NEFE HCL. RU SWAB. FL @ 1900'. END FL @ 5000'-SWAB DRY.
5-27-99: FL @ 4700'. ALL WTR, NO OIL OR GAS SHOWS. ACIDIZE PADDOCK PERFS 5158-5216' W/2000 GALS 15% NEFE HCL.
5-28-99: FL @ 4200'. END FL @ 5100'. SWABA DRY. TAG 83' FLUID ENTRY-ALL WTR. RD SWAB. TIH W/RDS.
5-29-99: TOH & LD TBG & PKR. NDBOP. NU FLANGE W/BALL VALVE. RIG DOWN.
WORKOVER UNSUCCESSFUL.
FINAL REPORT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 6/16/99

TYPE OR PRINT NAME J. Denise Leake


Telephone No. 397-0405


(This space for State Use)

APPROVED BY DISTRICT TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

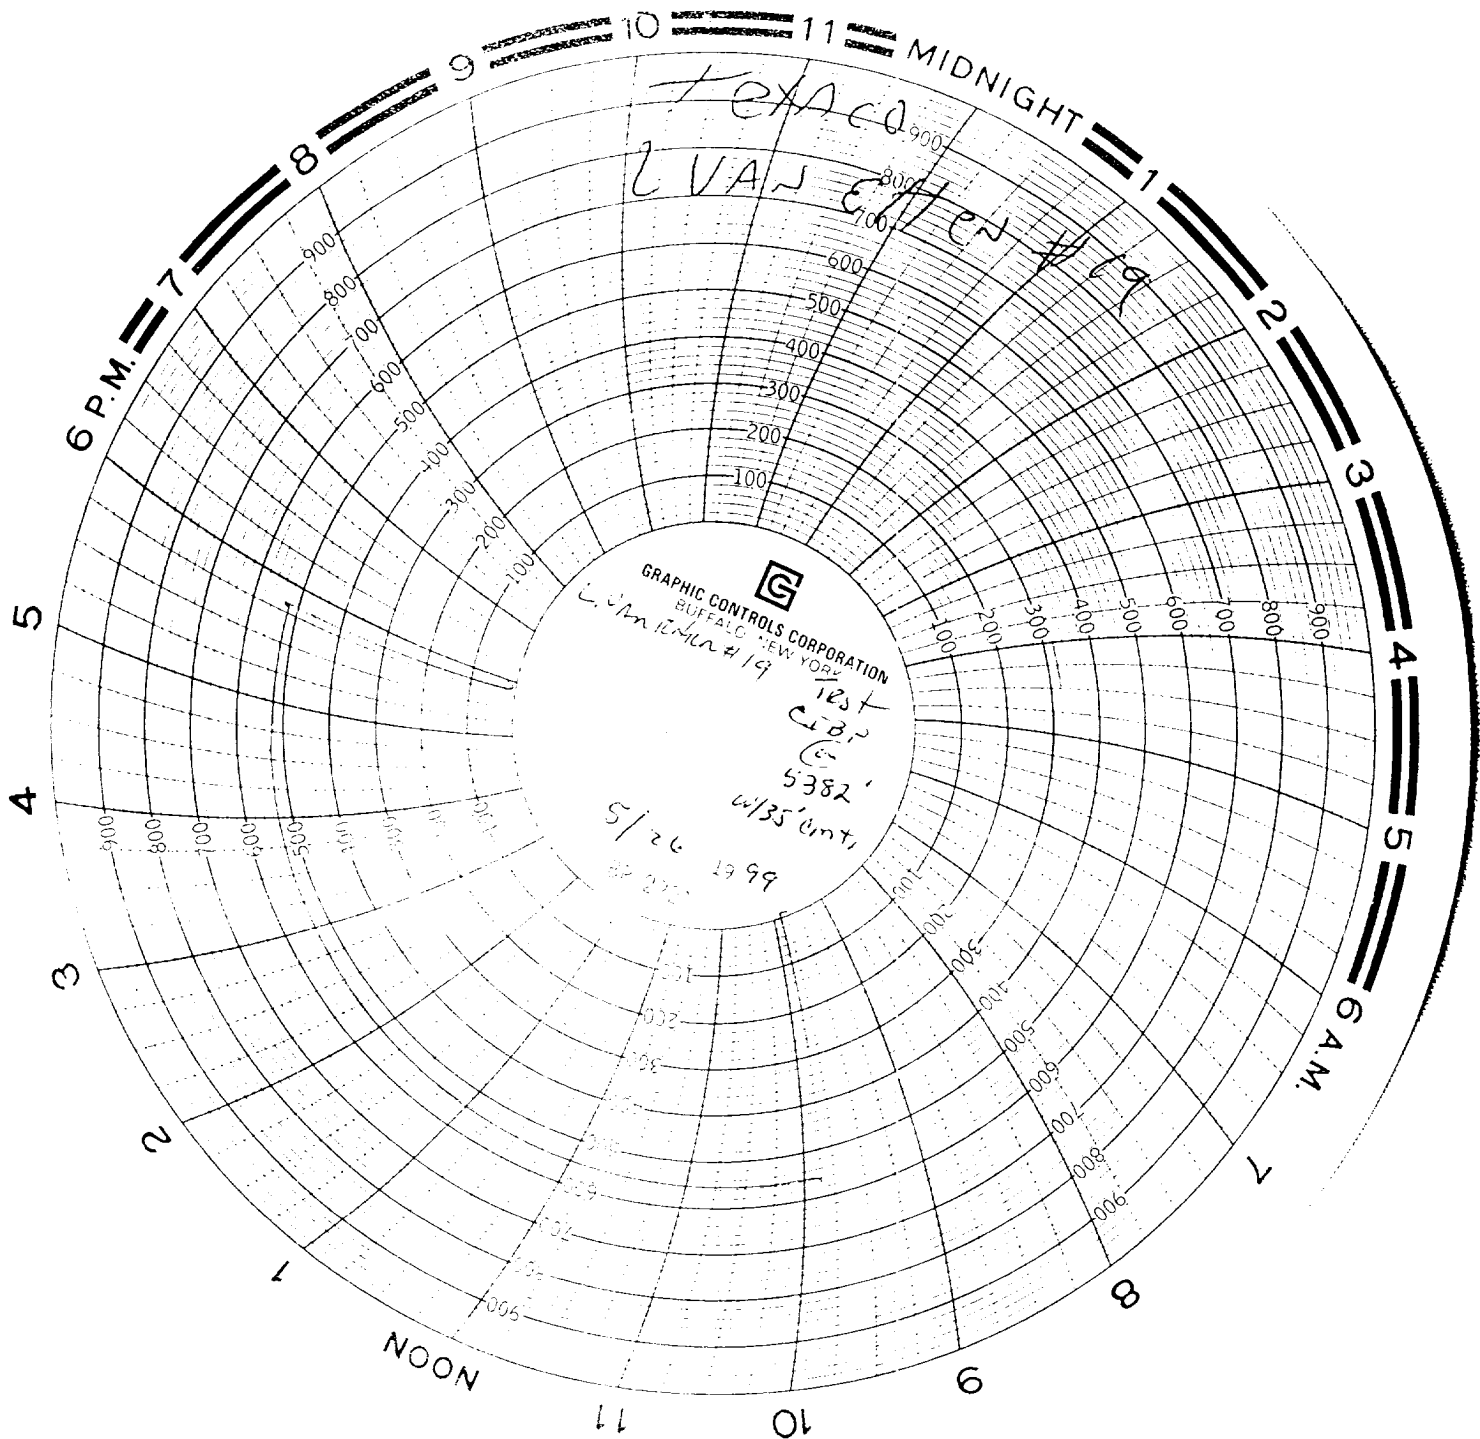

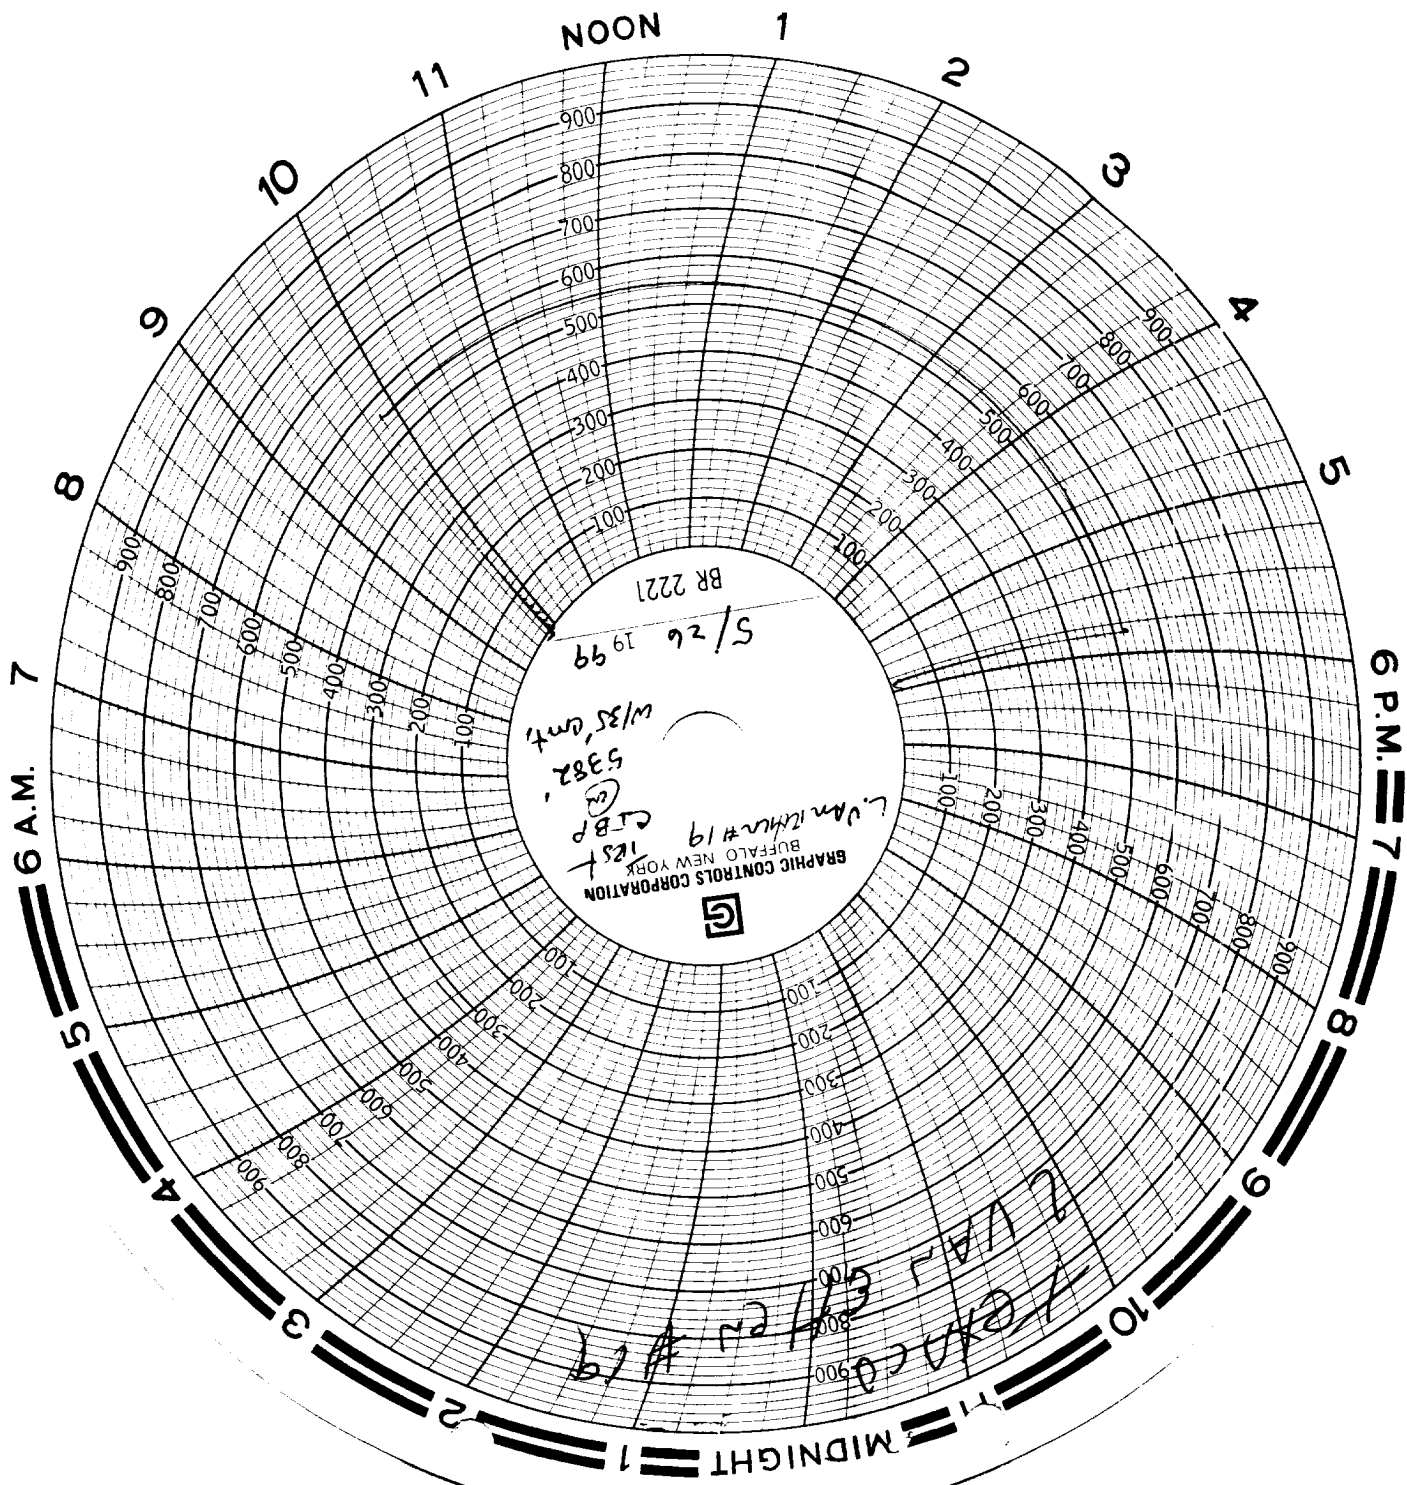

Chaparral
Hills for #33