

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	3002506061
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil / Gas Lease No.	NM 880620
7. Lease Name or Unit Agreement Name	WEIR, C. H. -B-
8. Well No.	4
9. Pool Name or Wildcat	MONUMENT TUBB

<p align="center">SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.</p>	
1. Type of Well:	<p>OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/></p>
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	PO BOX 3109, MIDLAND, TX 79702
4. Well Location	<p>Unit Letter <u>I</u> : <u>2044</u> Feet From The <u>SOUTH</u> Line and <u>660</u> Feet From The <u>EAST</u> Line</p> <p>Section <u>11</u> Township <u>20-S</u> Range <u>37E</u> NMPM <u>LEA</u> COUNTY</p>
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3534'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPERATION <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-20-01: TIH W/CIBP & SET @ 6340. (TA TUBB) DUMP 35' CMT ON CIBP. TIH W/CIBP #2 & SET @ 5721. (TA BLINEBRY) DUMP 35' CMT ON CIBP. TIH W/7 5/8" CIBP & SET @ 5258' (TA GLORIETA). DUMP 35' CMT ON CIBP.

2-22-01: OK PROCEDURE W/GARY WINK W/NMOCD.

2-23-01: DISPL CSG W/250 BBLs 9.5# GELLED BRINE MUD @ 25#/BBL. SET CIBP @ 3525'. DUMP 35' CMT ON PLUG IN 3 RUNS.

2-26-01: TAG CMT ON CIBP @ 3560. SPOT CMT PLUG ACR BASE OF SALT 2650-2346' W/60 SX CL C W/2% CACL. TAG CMT IN CSG @ 2428. SPOT CMT PLUG FR TOP OF SALT TO SURFACE SHOE 1600-1245 W/70 SX CL C W/2% CACL.

2-27-01: TAG CMT PLUG @ 1293'-OK. SPOT 60' CMT PLUG TO SURF BY DOWELL (15 SX CL C WS/2% CACL). FILL CSG TO SURFACE. RIG DOWN.

3-01-01: CUT OFF BRADENHEAD & INSTL DRY HOLE MARKER. CUT OFF DEADMEN. RIP LOCATION.

PLUGGED AND ABANDONED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 10/16/01

TYPE OR PRINT NAME J. Denise Leake Telephone No. 915-688-4752

(This space for State Use)

APPROVED [Signature] TITLE fld Rep DATE 11-5-02

CONDITIONS OF APPROVAL IF ANY: GWW