

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-

5a. Indicate Type of Lease  
State ☐ Fee ☒  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Texaco Producing Inc.	8. Farm or Lease Name C. H. Weir "B"
3. Address of Operator PO Box 728, Hobbs, New Mexico 88240	9. Well No. 5
4. Location of Well UNIT LETTER <u>G</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1650</u> FEET FROM THE <u>East</u> LINE, SECTION <u>11</u> TOWNSHIP <u>20S</u> RANGE <u>37E</u> N.M.P.M.	10. Field and Pool, or Wildcat Weir Blinbry East Skaggs Drinkard
15. Elevation (Show whether DF, RT, GR, etc.) 3609' DF	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐  
OTHER ☐

SUBSEQUENT REPORT OF:  
REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER Abandon Zones ☒  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work, SEE RULE 1103.

- MIRU. POH with pump and 2 3/8" tubing. NU BOP.
- Ran packer on 2 3/8" tubing. Set at 5320'. Could not pressure up, communicated. Release packer and POH.
- Ran in hole with 5 1/2" packer on 2 3/8" tubing. Set at 5321'. Junk at 5323'. Pressure up on tubing. Still communicated. POH with packer.
- Ran in hole with 4 1/2" shoe. Tag junk at 5318'. Cut a fish to 5319'. Mill from 19' to 5333'. POH with tools. Pick up and ran tension packer on 2 7/8" tubing. Set at 5327' and attempted to pressure up. (comm). POH.
- Pick up and ran 4 1/2" shoe on 2 7/8" tubing. Fish at 5333'. Wash down to 5345'. Stopped making hole. Circulated clean. POH with shoe. Recovered tubing. Pieces of rod. Start back in hole with tools. Tagged at 5345' and drilled to 5346'. POH. Shoe wore out. RIH with Arrow packer to 5344'.
- Establish rate of 1.5 BPM at 550#. Pumped 500 gallons 15% acid. Communicated. Completed job.
- POH with packer. RIH with packer to 5189', pumped in back side at 750# and .50 BPM. Pull up to 1463', same as above. Pulled up to 1401' and pressure back side to 1000#, held. POH with packer. RIH with retainer.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

397-3571

SIGNED Eddie W. Seay TITLE Hobbs Area Superint.

DATE 9/30/87

Eddie W. Seay

APPROVED BY Oil & Gas Inspector

TITLE

DATE

OCT 7 1987

CONDITIONS OF APPROVAL, IF ANY:

WEIR BLINBRY EAST  
SKAGGS DRINKARD

- 8) Set retainer at 5189'. Pumped 50 BFW thru retainer (Glorieta perfs 5250'-5318'). Top junk 5345'. Cement with 250 sxs Class "H" with .6% Halad 9 and 2% CaCl. Pulled out of retainer. Reversed out 1/4 bbls. cement. POH. WOC.
- 9) TIH with 4 3/4" bit. Tagged top of cement at 5140'. Drill to 5320'. Spot 1000 gallons 15% acid at 5320' up to 5100'. Attempt to put into old perfs 5318' up to 5250'. Could not break down. POH. RBIH with packer. Set at 4000'. Break down perfs at 2000#. Put acid away at 2 BPM. Release packer. POH. SI well 4/30/87.
- 10) MIRU. With 4" casing gun perf Glorieta zone 2 SPF 5281', 83, 92, 94, 5301', 03, 10, 12, 14, 16, 18, 11 int. 22 holes. TIH with 5 1/2" packer to 5204'. Acidize 5 1/2" casing perfs 5281'-5318' with 2000 gallons 15% NEFE. Slight ball action.
- 11) Release packer. TOH. Ran production equipment. POB 8/14/87. On test, pumped 85 BWPD. SI well and evaluate for recompletion.

**RECEIVED**

**OCT 6 1987**

**OCD**

**HOBBS OFFICE**