	• • •		
rm 3160-5	UNITED ST	ATES	FORM APPROVED
.ie 1990)	DEPARTMENT OF TH	EINTERIOR	Budget Bureau No. 1004-0135
,	BUREAU OF LAND MA		Expires: March 31, 1993
		· · · · · · · · · · · · · · · · · · ·	5. Lease Designation and Serial No.
	SUNDRY NOTICES AND RE		NM-557686Ø
	6. If Indian, Allottee or Tribe Name		
	roposals to drill or to deepen or re ION FOR PERMIT" for such prop	•	
Use Arriconn			7. If Unit or CA, Agreement Designation
T	SUBMIT IN TRIPLIC		
Type of Well	INJECTION		
Well Well	8. Well Name and No.		
Name of Operator			SEMU PERMIAN WELL # 44
CONOCO INC.			9. API Well No.
Address and Telephone No.			30-025-06084
	W, MIDLAND, TX. 79705 (915) 686	- 5424	10. Field and Pool, or Exploratory Area
Location of Well (Footage, Sec., T.	٢	SKAGGS GRAYBURG	
SURFACE: 660' FSL & 66	R., M., or Survey Description)	NIT LTR 'M' 🗸	11. County or Parish, State
TD: Same	6		LEA, NM
CHECK APPROPR	ATE BOX(s) TO INDICATE NA	ATURE OF NOTICE, REPORT, O	R OTHER DATA
TYPE OF SUBM	IISSION	TYPE OF ACTION	{
Notice of Intent		Abandonment	Change of Plans
·· —		Recompletion	New Construction
X Subsequent Re	iport	Plugging Back	Non-Routine Fracturing
X Subsequent Report			
		Casing Repair	Water Shut-Off
			Conversion to Injection
Final Abandonm	nent Notice	Attering Casing	
Final Abandonr	nent Notice	X Other	Dispose Water
Describe Proposed or Completed	d Operations (Clearly state all pertinent details,		Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of startling any proposed work. If well is
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive	X Other Add pay and stimulate and give pertinent dates, including estimated date al depths for all markers and zones pertinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of startling any proposed work. If well is
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD	X Other Add pay and stimulate and give pertinent dates, including estimated date al depths for all markers and zones pertinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi
Describé Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive	X Other Add pay and stimulate and give pertinent dates, including estimated date al depths for all markers and zones pertinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive	X Other Add pay and stimulate and give pertinent dates, including estimated date al depths for all markers and zones pertinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi
 Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well 	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give pertinent dates, including estimated date al depths for all markers and zones pertinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi wn w.s. RIH w/ IPC tubing and packer. Set p
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulat cker at 3600'. Load backside. R.U. Acid equi wn w.s. RIH w/ IPC tubing and packer. Set p
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulat cker at 3600'. Load backside. R.U. Acid equi wn w.s. RIH w/ IPC tubing and packer. Set p
Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulat cker at 3600'. Load backside. R.U. Acid equi wn w.s. RIH w/ IPC tubing and packer. Set p
3 Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi wn w.s. RIH w/ IPC tubing and packer. Set p
3 Describe Proposed or Completed directionally drilled, give subs 11-13-95 MIRU. Relea POH. RUWI Acidize well	d Operations (Clearly state all pertinent details, surface locations and measured and true vertica ase packer. NUBOP. POH w/ tubing a 'L. Perforate 3690' - 3764' w/ 4spf. RD I with 5500 gals. 15% HCL-NEFE dive Circulate packer fluid. Run MIT test.	X Other Add pay and stimulate and give perlinent dates, including estimated date al depths for all markers and zones perlinent to this nd packer. GIH with w.s., bit and D.C.,s WL. GIH w/ packer and w.s. and set par enting with 4500 # rock salt. POH, lay door	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is s work.)* . Tag fill at 3890' Clean out to 3910'. Circulate cker at 3600'. Load backside. R.U. Acid equi wn w.s. RIH w/ IPC tubing and packer. Set p

Signed My Kulture	Ann E. Ritchie Title REGULATORY AGENT	Date 12-18-95				
(This space for Federal or State office use)						
Approved by Conditions of approval, if any	Title	Date				
Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.						



.