State of New Mexico

to Appropriate District Office	Ene	rgy, Minerals and N	latural R	esources Department			Revised 1-1-89
DISTRICT I	OIL	CONSERV	ATI	ON DIVISION	WELL API NO.		
P.O. Box 1980, Hobbs, N	M 88240		3ox 208		WELL API NO.	3002506132	
DISTRICT II		Santa Fe, New			5. Indicate Ty		
P.O. Box Drawer DD, Arte	sia, NM 88210	ountare, new	IVICAIC	0 07304-2000	J. marcate 1	STATE	FEE 🔲
DISTRICT III 1000 Rio Brazos Rd., Azte	0. NM 97410				6. State Oil /	Gas Lease No.	
		ND PEDODTS (DNI WIE	1		770430	***************************************
SUNDRY NOTICES AND REPORTS ON WELL (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)						e or Unit Agreement N	lame
Type of Well: OIL WELL	⊠ GAS □	OTHER					
Name of Operator TEXACO EXPLORATION & PRODUCTION INC.						1	
3. Address of Operator	205 E. Bender, HOBB	S, NM 88240	***************************************		9. Pool Name EUNICE MC	or Wildcat NUMENT GRAYBURG	SAN ANDRES
4. Well Location							DAIN ANDRES
Unit Letter	N : 330	Feet From The	SOUT	H Line and 1650	_ Feet From T	he <u>WEST</u> Lin	ie
Section 16	Towns	<u>'</u>		ange 37E NM	IPM	LEA_COL	JNTY
	10. Ele	evation (Show wheth	er DF, RK	B, RT,GR, etc.)			
11.	Check Appropria	ate Box to Indic	ate Na	ure of Notice, Report	, or Other I	Pata	
NOTICE OF	INTENTION TO:			SU	IBSEQUE	NT REPORT OF	Ξ.
PERFORM REMEDIAL WORI	K PLUG AI	ND ABANDON		REMEDIAL WORK	 ☑	ALTERING CASING	
TEMPORARILY ABANDON	☐ CHANGE	PLANS		COMMENCE DRILLING OPE	RATION	PLUG AND ABANDON	
PULL OR ALTER CASING				CASING TEST AND CEMEN			
OTHER:			_ 🗆	OTHER:		TO GRAYBURG	\boxtimes
any proposed work) SE 2-12-99: MIRU, BLED OFF 3530', TIH WTO 5058', PSI 2-15-99: RAN ULTRA SON TEST TO 5000 PSI, PSA 30 2-16-99: RU SWAB, FL @ PERF, NO BALL ACTION, 2-17-99: FL @ 2800', SWA 2-18-99: FL @ 2800', SWA PUMP IN 2 STGS, FL @ S0 2-19-99: FL @ 2400', SWA TO 3500', CIRC HLE W/140 3400', 2-20-99: LD WS, NDBOP, WORKOVER UNSUCCESS FINAL REPORT	TO VAC TRUCK, UNICSG TO 520 PSI FOR SIC CEMENT IMAGER 667', LOAD & PSI CSG 500', SWAB DRY, B DRY, B. PRESS BACKSIDE URF, SWAB-NO GAS OB DRY, REL PKR & TO BBLS PKR FLUID, TE NUWH, RIG DOWN, N	T30 MIN. CHART O LOG FR 4200-3000 TO 500 PSI-OK. B ACIDIZE PERFS 37 /. TO 500#-OK. RE-A DR OIL. DH. TIH W/BAILER EST & CHART FOR	K. Y. TIH W REAKDO 722-3746 CIDIZE I & DUMP NMOCE (TA'D)	/PERF GUN. PERF CSG F DWN PERFS @ 1500 PSI (6 ' W/1000 GALS 15% NEFE LINER PERFS 3722-46' W/	FR 3722-46'. "-" @ 1 1/2 BPM. I E HCL & 100 7/ 2000 GALS 15 JG. PBTD @ 3 JK. NOTIFY SY	IH W/PKR, SN, & 2 3/ PUMP 5 BBLS. '8" RCN BALLS. FLSH 5% NEFE HCL & 500# 637'. TIH W/TBG OPE 'LVIA-NMOCD. PULL	8" TBG. H TO BTM RK SLT.
SIGNATURE TYPE OR PRINT NAME	J. Denise	KeTITLE_		eering Assistant)	DATE <u>3/15/9</u>	9
(This space for State Use)	CHIT .		æ	18 N. d. "The			
APPROVED BY		TITLE	- 6	19,00		DATE	
CONDITIONS OF APPROVAL	, IF ANY:		1	1000			