

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

Correction

5a. Indicate Type of Lease

State ☒ Fee ☐

5. State Oil & Gas Lease No.

B-159

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name Eunice Monument Un
2. Name of Operator Texaco Inc.	8. Farm or Lease Name Eunice Monument Un
3. Address of Operator P.O. Box 728, Hobbs, New Mexico 88240	9. Well No. 4
4. Location of Well UNIT LETTER <u>A</u> , <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>19</u> TOWNSHIP <u>20-S</u> RANGE <u>37-E</u> N.M.P.M.	10. Field and Pool, or Wildcat <u>Eunice - Monument</u>
15. Elevation (Show whether DF, RT, GR, etc.) 3540' (DF)	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rigged up. Pull rods & pump. Install BOP. Pull tubing.
2. Clean Out to TD (3865'). Log Well.
3. String Shot open-hole 3798' - 3848' w/800 grain shot. Clean out.
4. Set pkr. @ 3429'. Acidize open-hole 3620' - 3868' w/3000 gals. 20% NEFE Acid in 2-Equal Stages using 500# rock salt between stages.
5. Install pumping equipment & test.
6. Pull rods & pump. Install BOP. Pull tubing.
7. String shot open-Hole 3795' - 3845'. Clean out spot sand @ 3865' & cement from 3865' - 3853' (PBTD).
8. Set pkr. @ 3520'. Acidize 5 1/2" open-hole 3620' - 3853' w/3000 gals. 15% NE Acid in 3-stages using 300# rock salt after 1st stage & 700# rock salt after 2nd stage incorporating 2 drums Scale inhibitor into

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *Les Clements* TITLE Asst. Dist. Manager DATE 7-6-82
 APPROVED BY Oil & Gas Insp. TITLE _____ DATE _____
 CONDITIONS OF APPROVAL, IF ANY: _____

JUL 21 1982