

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
B-160	

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator		8. Farm or Lease Name
TEXACO Inc.		Eunice Monument Unit
3. Address of Operator		9. Well No.
P. O. Box 728, Hobbs, New Mexico 88240		26
4. Location of Well		10. Field and Pool, or Wildcat
UNIT LETTER <u>K</u> , <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM		Eunice Monument
THE <u>West</u> LINE, SECTION <u>20</u> TOWNSHIP <u>20-S</u> RANGE <u>37-E</u> NMPM.		Grayburg San Andres
15. Elevation (Show whether DF, RT, GR, etc.)		12. County
3527' (DF)		Lee

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rigged up. Pull rods & pump. Install BOP.
2. Ran 500 grain string shot across open-hole section 3730' - 3810'. Clean out fill.
3. Ran 500 grain string shot across open-hole section 3730' - 3810'. Clean out fill.
4. Ran Pkr. & set @ 3558'. Spot 250 Gals. 20% NEFE Acid across open-hole Section 3644' - 3824'.
5. Reset Pkr. @ 3396'. Frac Open-hole 3644' - 3824' w/400 Gals. 20% NEFE Acid, 10,000# gel. water & 12000# 20/40 Sand. Sanded out. Clean out.
6. Set Pkr. @ 3388'. Frac open-hole 3644' - 3824' w/20,000 gals. FW gel & 15,500# 20/40 Sand in 2-equal stages using 600# rock salt between stages.
7. Install pumping equipment. Test & place on production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Asst. Dist. Supt. DATE 9-14-81

APPROVED BY Jerry Sexton TITLE Asst. Dist. Supt. DATE SEP 16 1981

CONDITIONS OF APPROVAL, IF ANY: