

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TR
(Other Instructi
Reverse side)

CATE
on

Revised Edition of 1981
Expires August 31, 1985

2. LEASE DESIGNATION AND SERIAL NO.

MMO-557686X

3. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

SENU-Perman

8. FARM OR LEASE NAME

9. WELL NO.

#36

10. FIELD AND POOL, OR WILDCAT

Stagg's Grayburg

11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA

S24, T20S, R37E

12. COUNTY OR PARISH

Wyo

13. STATE

Wyo

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Injection

2. NAME OF OPERATOR

Conoco Inc.

3. ADDRESS OF OPERATOR

PO Box 460, Hobbs, NM 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

Well A 664/1-5

14. PERMIT NO.

33-025-0625300

15. ELEVATIONS (Show whether DP, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Repair csg. leak

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

10/2/89 Notified BLM before RD.
MIRU - Install BOP, POH w/ 113 lbs. 2 3/8" cmt lined 4bg. + 5-1/2" Baker AD-1. Start in hole w 5-1/2" BP. Test PKR. + PL 2 7/8" ws. Set RBP at 3610' + PKR at 3600' + test RBP. WITH - w/ 5-1/2" hcs-set + test PKR. Set RBP at 3590' + PKR at 3560'. Test RBP to 1000 psi. Move packer & test 1000 psi - pumpdown surface csg. 2 bpm @ 150 psi. POH w/ PKR + ~~down~~ Shutdown on.
Tag Fltmt @ 70' no cmt in csg. Tag sandon PKR at 3545' no cmt on PKR Test csg. to 500 psi @ 1/30 min-ok. POH laying down 2 7/8" ws. 3-3 1/2" PC. + 4 3/4" bit. Shutdown. WITH w 5-1/2" Baker AD-1 + 113 lbs. 2 3/8" cmt lined 4bg. RD. BOP. TOP of backside + test w/ chart @ 500 psi @ 1/15 min. Return well to water injection!

18. I hereby certify that the foregoing is true and correct.

SIGNED Wm Baker Wm Baker

TITLE Admin. Supervisor

DATE 2/1/90

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side