

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2068
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEFEEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
SEE INSTRUCTIONS FOR PERMIT FROM CHECK FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	5a. Indicate Type of Lease State ☐ Fee ☒
2. Name of Operator Sun Exploration & Production Co.	5. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 1861, Midland, Texas 79702	7. Unit Agreement Name
4. Location of well UNIT LETTER D 440 FEET FROM THE North LINE AND 440 FEET FROM THE West LINE, SECTION 29 TOWNSHIP 20-S RANGE 37-E N.M.P.M.	8. Farm or Lease Name A.B. Reeves
	9. Well No. 2
	10. Field and pool, or tract Eumont-Yates Seven Ryrs Queen (Pro Gas)
11. Elevation Show whether LF, RT, GR, etc.) 3517' GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
FULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPER. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe in brief or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU pulling unit. Install BOP. Lower tbg, latch onto pkr @3338'. Retrieve blanking plug. RIse pkr and POH w/ 2-7/8" tbg.
RIH w/ 2-7/8" tbg O.E., load hole w/ 9.5# mud lader fluid. POH.
RIH w/ 5 1/2" CIBP on 2-7/8" tbg. Set CIBP @ 3375'+. Spot 4 sx cmt on top CIBP. POH.
Perf 5 1/2" csg at 2845', 4 holes, w/4" CG. RIH w/ 2-7/8" tbg and spot 100' cmt plug from 2845-2745', PU tbg, WOC, tag top of plug and POH.
Perf 5 1/2" csg at 1175' (top salt-1178'), 4 holes, w/4" CG. RIH w/ 2-7/8" tbg and FB pkr. Set pkr @1075', test csg.* (Reset pkr if necessary until csg holds). EIR into perfs. POH.
RIH w/5 1/2" cmt retainer and set at 1075+. Pump approx 450sx cmt into perfs and attempt to circ cmt. Leave 100' cmt plug inside 5 1/2" csg. Snap out of ret. Dump 2 sx cmt on top of ret & POH. Spot 10 sx cmt inside 5 1/2" csg at surface. Cut off csg 4' below surf. Weld on steel plat, set permanent marker. Clean up loc.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Des Ann Kemp

TITLE Senior Acctg. Assist.

DATE Nov. 1, 1983

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____

TITLE _____

DATE NOV 4 1983

CONDITIONS OF APPROVAL, IF ANY: