

EMSU # 112  
API # 30-025-06282  
1980' FNL & 1980' FEL  
S30, T20S, R36E, & Unit G  
Eunice Monument South Unit  
Lea County, New Mexico

February 15, 2001

PROCEDURE TO TEMPORARILY ABANDON WELL:

Notify OCD/BLM 24 hrs prior to work commencing.

1. Verify anchors have been set & tested.
2. MIRU PU, ND WH, NU BOP.
3. TOH w/ tbg. TIH w/5-7/8" bit, csg scraper, & WS. Make bit trip to 3650', POH.
4. Set CIBP @ 3630'. Dump 3 sx Class 'C' cmt on CIBP.
5. TIH w/WS to TOC. Circulate csg w/corrosion inhibited pkr fluid. TOH.
6. Perform MIT (500 PSI for 30 min.).
7. ND BOP. NU WH. RD PU.
8. Clean and clear location.

T. Love 687-7645