

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-06793
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Chevron USA, Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd. Midland, Tx 79705		7. Lease Name or Unit Agreement Name: Sarkeys, S.J.
4. Well Location Unit Letter <u>C</u> : 660 feet from the <u>north</u> line and <u>1980</u> feet from the <u>west</u> line Section <u>26</u> Township <u>21-S</u> Range <u>37-E</u> NMPM County <u>Lea</u>		8. Well No. 3
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Penrose, Skelly, Grayburg <u>50350</u>

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU

2. RIH Tag 5 1/2 CIBP @ 3790, spot 35sx plug 3790-3400(Grayburg, Queen) WOC Tag.

3. Displace hole w/MLF, 9.5# Brine w/25# Gel P/BBL.

4. Perf 4 holes @ 2850, sqz 90sx plug 2850-2400(8 5/8 shoe, Yates, B-salt) WOC Tag.

5. Perf 4 holes @ 1400, sqz 50sx plug 1400-1200(T-salt)WOC Tag.

6. Perf 4 holes @ 350, sqz 200sx plug 350-surf 5 1/2X 8 5/8X 13 3/8 csgs (13 3/8 shoe, surface) WOC Tag.

7. Install dry hole marker.

THIS COMMISSION MUST BE NOTED BY 24
HOURS PRIOR TO THE BEGINNING OF
PROPOSED OPERATIONS FOR THE C-103
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE G. R. Bledsoe

TITLE HES Specialist

DATE 11/1/2002

Type or print name G. R. Bledsoe

Telephone No. 915.687.7153

(This space for State use)

APPROVED BY

ORIGINAL SIGNED BY

GARY W. TITLE

DATE NOV - 7 2002

Conditions of approval, if any:

OCD FIELD REPRESENTATIVE H/STAFF MANAGER

G. R. Bledsoe 3-5-03 AY