	240	erals and Natural		WELL API NO.	Revised March 25, 199
1301 W. Grand Avenue, Artesia, N. District III		ERVATION D		30-025-06835 5. Indicate Type	
1000 Rio Brazos Rd., Aztec, NM 87 District IV		South St. Francia Fe, NM 8750	DI.	STATE	
1220 S. St. Francis Dr., Santa Fe, N.	M 87505	arc, INIVI 6/30	13	6. State Oil & G	
DIFFERENT RESERVOIR. USE "PROPOSALS.) 1. Type of Well:	APPLICATION FOR PERMIT" (DEEDENI OD DE	BACK TO A UCH	7. Lease Name or Central Drinka	Unit Agreement Nam rd Unit
2. Name of Operator Ch	ell LJ Other			8. Well No.	
3. Address of Operator 15 Smith Rd. Midland, Tx 79705				100	
4. Well Location				Pool name or Brunson Ellen Bi	Wildcat ungen S.A.
	1000				
Unit Letter 1	1980 feet from	the south	_ line and <u>990</u>	feet from	the east line
Section 28	Township	21-S Range	37-E	IMPM	County Lea
	10. Elevation (Sho				and the second
11. Che	ck Appropriate Box to FINTENTION TO:	Indicate Natur	e of Notice, Re	port or Other D	ata
PERFORM REMEDIAL WORK	L 11/11 L 1/11/11 11/11/11/11/11/11		SUBSE MEDIAL WORK	QUENT REPO	ORT OF:
TEMPORARILY ABANDON	CHANGE PLANS		MMENCE DRILLI		ALTERING CASING
PULL OR ALTER CASING	MULTIPLE COMPLETION	CA	SING TEST AND		PLUG AND ABANDONMENT
	COM ELTION	UE	MENT JOB		
OTHER:					
12. Describe proposed or co	ompleted operations. (Cle	orly state all	HER: nent details, and gi	ve pertinent dates,	including estimated da
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD we 2. Displace hole w/ML 3. Spot 40sx plug fr/364. Perf 4 holes @ 28065. Perf 4 holes @ 3507. Top of well w/5sx fr/	00 spot 25sx plug fr/4000 I/Buddy. F 9.5# Brine w/25# Gel p 500-3400(Queen) 0 unable to sqz spot 45sx 0 sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9) '30sx to surf, Install dry h	arly state all pertinor Multiple Comp -3900(San Andro b/BBL. x fr/2850-2600(9 T-salt) Tag @ 1 5/8X13 3/8 shoe nole marker 10-	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur	left in hole CIBP	proposed completion
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD we 2. Displace hole w/ML 3. Spot 40sx plug fr/364. Perf 4 holes @ 28065. Perf 4 holes @ 3507. Top of well w/5sx fr/	00 spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 500-3400(Queen) 0 unable to sqz spot 45sx 0 sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9 stantal) (30sx to surf, Install dry fr	arly state all pertinor Multiple Comp -3900(San Andro b)/BBL. x fr/2850-2600(9 T-salt) Tag @ 1 5/8X13 3/8 shoe hole marker 10-	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur	left in hole CIBP	proposed completion
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD w. 2. Displace hole w/ML. 3. Spot 40sx plug fr/36. 4. Perf 4 holes @ 2800. 5. Perf 4 holes @ 1400. 6. Perf 4 holes @ 350. 7. Top of well w/5sx fr/	200 spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 200-3400(Queen) 0 unable to sqz spot 45sx 0 sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9):/30sx to surf, Install dry fr Approved as to pluggir Liability under total is surface restoration is contact to the contact contact to t	arly state all pertinor Multiple Comp -3900(San Andro b/BBL. x fr/2850-2600(9 T-salt) Tag @ 1 5/8X13 3/8 shoe hole marker 10- hig of the Well E	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur -15-02	left in hole CIBP	proposed completion
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD w. 2. Displace hole w/ML. 3. Spot 40sx plug fr/36. 4. Perf 4 holes @ 2800. 5. Perf 4 holes @ 1400. 6. Perf 4 holes @ 350. 7. Top of well w/5sx fr/	200 spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 200-3400(Queen) 0 unable to sqz spot 45sx 0 sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9):/30sx to surf, Install dry fr Approved as to pluggir Liability under total is surface restoration is contact to the contact contact to t	arly state all pertinor Multiple Comp -3900(San Andro b/BBL. x fr/2850-2600(9 T-salt) Tag @ 1 5/8X13 3/8 shoe hole marker 10- hig of the Well E	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur -15-02	left in hole CIBP	proposed completion
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD we 2. Displace hole w/ML 3. Spot 40sx plug fr/364. Perf 4 holes @ 2800 5. Perf 4 holes @ 1400 6. Perf 4 holes @ 350 7. Top of well w/5sx fr/	OD spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 600-3400(Queen) O unable to sqz spot 45sx of 50 sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9) t/30sx to surf, Install dry the Approved as to pluggir Liability under read is surface restoration is careful from the control of the c	arly state all pertinor Multiple Composition Androy (San Androy (BBL.) of fr/2850-2600(9) T-salt) Tag @ 1 5/8X13 3/8 shoes note marker 10- ag of the Well Extrained until completed.	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur 15-02	Tag @ 2565 f sqz w/200sx	proposed completion
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD w. 2. Displace hole w/ML. 3. Spot 40sx plug fr/36. 4. Perf 4 holes @ 2800. 5. Perf 4 holes @ 350. 7. Top of well w/5sx fr/	OD spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 500-3400(Queen) O unable to sqz spot 45st o sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9) t/30sx to surf, Install dry harmonic from the free from the surface restoration is contained by the free from the free free free free free free free fr	arly state all pertinor Multiple Comp -3900(San Andro)/BBL. of fr/2850-2600(9 T-salt) Tag @ 1 5/8X13 3/8 shoe hole marker 10 ong of the Well Be cetained until ompleted.	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur 15-02	Tag @ 2565 f sqz w/200sx	& setting tool @
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD we 2. Displace hole w/ML 3. Spot 40sx plug fr/364. Perf 4 holes @ 2800 5. Perf 4 holes @ 1400 6. Perf 4 holes @ 350 7. Top of well w/5sx fr/	OD spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 600-3400(Queen) O unable to sqz spot 45sx of 50 sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9) t/30sx to surf, Install dry the Approved as to pluggir Liability under read is surface restoration is careful from the control of the c	arly state all pertinor Multiple Comp -3900(San Andro)/BBL. of fr/2850-2600(9 T-salt) Tag @ 1 5/8X13 3/8 shoe hole marker 10 ong of the Well Be cetained until ompleted.	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur 15-02 Bore.	Tag @ 2565 f sqz w/200sx or of the control of the	Soft October 2001 Proposed completion & setting tool @
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD we 2. Displace hole w/ML 3. Spot 40sx plug fr/364. Perf 4 holes @ 2800 5. Perf 4 holes @ 350 7. Top of well w/5sx fr/ I hereby certify that the information of the space for Signature. Type or print name This space for Signature.	OD spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 500-3400(Queen) O unable to sqz spot 45sx o sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9) t/30sx to surf, Install dry the Approved as to pluggir Liability under total is surface restoration is continuated to the continuation of the continuation of the continuation above is true and complete the continuation of the continua	arly state all pertinor Multiple Comp -3900(San Andro)/BBL. of fr/2850-2600(9 T-salt) Tag @ 1 5/8X13 3/8 shoe hole marker 10 ong of the Well Be cetained until ompleted.	nent details, and gi letions: Attach we es) Tag @ 3849 5/8 shoe,B-salt) 180)Tag @ 30 fr/sur 15-02 Bore.	Tag @ 2565 f sqz w/200sx or of the control of the	& setting tool @
of starting any proposed we or recompilation. 1. Set 7" CIBP @ 400 4480 Ok w/OCD we 2. Displace hole w/ML 3. Spot 40sx plug fr/364. Perf 4 holes @ 2800 5. Perf 4 holes @ 1400 6. Perf 4 holes @ 350 7. Top of well w/5sx fr/	OD spot 25sx plug fr/4000 t/Buddy. F 9.5# Brine w/25# Gel p 500-3400(Queen) O unable to sqz spot 45sx o sqz 75sx fr/1400-1200(circ cmt fr/350-surf(7X9) t/30sx to surf, Install dry the Approved as to pluggir Liability under total is surface restoration is continuated to the companion of the Approved is true and companion above is true above is true and companion above is true and companion above is true above is true above is true above is true and companion above is true above is true and companion above is true ab	arly state all pertinor Multiple Comp -3900(San Andre -	nent details, and giletions: Attach were sold as the ses) Tag @ 3849 5/8 shoe, B-salt) 180)Tag @ 30 fr/sur. 15-02 Bore.	Telephon	Soft October 2001 Proposed completion & setting tool @

てじら