

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	WELL API NO. 30-025-06835
2. Name of Operator Chevron USA, Inc.	5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
3. Address of Operator 15 Smith Rd. Midland, Tx 79705	6. State Oil & Gas Lease No.
4. Well Location Unit Letter <u>I</u> , 1980 feet from the <u>south</u> line and <u>990</u> feet from the <u>east</u> line Section <u>28</u> Township <u>21-S</u> Range <u>37-E</u> NMPM County <u>Lea</u>	7. Lease Name or Unit Agreement Name: Central Drinkard Unit
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	8. Well No. 100
	9. Pool name or Wildcat Brunson Ellen Bungen S.A.

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. **Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Set 7" CIBP @ 4000 spot 25sx plug fr/4000-3900(San Andres) Tag @ 3849 left in hole CIBP & setting tool @ 4480 Ok w/OCD w/Buddy.
2. Displace hole w/MLF 9.5# Brine w/25# Gel p/BBL.
3. Spot 40sx plug fr/3600-3400(Queen)
4. Perf 4 holes @ 2800 unable to sqz spot 45sx fr/2850-2600(9 5/8 shoe,B-salt) Tag @ 2565
5. Perf 4 holes @ 1400 sqz 75sx fr/1400-1200(T-salt) Tag @ 1180
6. Perf 4 holes @ 350 circ cmt fr/350-surf(7X9 5/8X13 3/8 shoe)Tag @ 30 fr/surf sqz w/200sx
7. Top of well w/5sx fr/30sx to surf, Install dry hole marker 10-15-02

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

NOT 2002
RECEIVED
HOBBS
OCD

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jimmy Bagley TITLE MANAGER/SUNSET DATE 10-15-02

Type or print name Jimmy BAGLEY

Telephone No. 915 520 8756

APPROVED BY GARY W. WINK TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE

Conditions of approval, if any:

GWV

FEB 11 2003

3-6-03