

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	
State ☐	Fee ☒
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER		7. Unit Agreement Name
2. Name of Operator TEXACO INC.		8. Farm or Lease Name V. M. Henderson
3. Address of Operator P.O. BOX 728, HOBBS, NM 88240		9. Well No. 8
4. Location of Well UNIT LETTER <u>E</u> <u>660</u> FEET FROM THE <u>West</u> LINE AND <u>1980</u> FEET FROM THE <u>North</u> LINE, SECTION <u>30</u> TOWNSHIP <u>21-S</u> RANGE <u>37-E</u> NMPM.		10. Field and Pool, or Wildcat Drinkard, Paddock & Penrose Skelly
15. Elevation (Show whether DF, RT, GR, etc.) 3510' (DF)		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up. Install BOP.
2. Set CIBP in 2-3/8" (Former Drinkard) csg @ 5100' & spot 40' cement on plug.
3. Set CIBP in same string @ 3350' & spot 40' cement on plug.
4. Set CIBP in Penrose Skelly string & spot 40' cement on plug.
5. Establish freepoint in all three strings, cut & pull same.
6. Perforate 8-5/8" csg w/2 JS @ 1370'.
7. Set cement retainer @ 1300'. Cement to surf csg perfs @ 1370' w/600 sx Cl H cmt containing 2% CaCl. Leave retainer in hole.
8. Spot 35 sx cmt plug from 379-279'.
9. Spot 10 sx cmt plug @ surf.
10. Install Dry Hole Marker. Clean Location. Plug & Abandon Well.

COPIES OF THIS REPORT
TO BE FURNISHED TO
THE FOLLOWING OFFICES
AND INDIVIDUALS
AS REQUESTED BY THE
OPERATOR

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Asst. Dist. Mgr. DATE 11-18-83

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

NOV 9 1983