

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: E.O. CARSON Well No. 8

Field: BLINEBRY-TUBB

County: LEA State: NEW MEXICO

RECOMMENDED PROCEDURE:

1. Move in a pulling unit, kill the well, and pull the pro-
ducing equipment.

2. Run the squeeze tubing to the Model "D" Packer and squeeze
the Tubb perms. (6125'-6330'-2050A-332 Holes) with
class "H" cement.

3. Set a plug in the Model "D" Packer at 6100'. Squeeze
the Blinebry perms. (5499'-5591'-970A-272 Holes) with
class "H" cement.

4. Drill out the cement, Model "D" Packer, and clean
the well out to P.B.T.D. (6488').

5. Turn the wellbore over to the Central Drinkard
Unit.

Note: The Central Drinkard Unit will drill out the 12'
cement plug at 6488', and the bridge plug
at 6500' for the recompletion of the Drinkard
formation.

MS 8-18-72

Oper. Engr.