

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN PLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-013
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	5. LEASE DESIGNATION AND SERIAL NO. LC-032096A
2. NAME OF OPERATOR Conoco Inc.	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P.O. Box 460 - Hobbs, New Mexico 88240	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FNL & 1980' FWL Unit C	8. FARM OR LEASE NAME Lockhart A-35
14. PERMIT NO. 30-025-07032	9. WELL NO. 3
15. ELEVATIONS (Show whether DF, RT, CR, etc.)	10. FIELD AND POOL, OR WILDCAT Blinebry/Drinkard/Tubb
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 35, 21S, 37E
	12. COUNTY OR PARISH Lea
	13. STATE NM

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

REPAIRING WELL
ALTERING CASING
ABANDONMENT*

Downhole Commingle

XX

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and tones pertinent to this work.)

MIRU. Blow down wellhead pressure. POOH w/rods & pumps. Kill well. POOH w/tubing. Mill over Model D pkr. Drill out to bottom slips on pkr. POOH w/RBP. Clean out fill. Mill out pkr. Pressure test tubing to 5000 psi. Set RBP @ 6328' & pkr @ 5923'. Acidize Tubb perms from 5952'-6293' w/20 bbls of acid mixture (1050 gals Xylene & 3150 gals 15% NE-FE-HCL acid inhibited) & 200# graded rocksalt in 3 bbls gelled 10# brine, pmp 20 bbls of acid & 200# of graded rocksalt in 3 bbls gelled brine, pmp 10 bbls acid & flush w/50 bbls of 2% KCL-TFW w/1:1000 gals Adomall. Rel pkr & RBP. PU & set RBP @ 5923' & pkr @ 5302'. Acidize Blinebry perms from 5473'-5890' w/25 bbls acid mixture & 140# graded rocksalt in 2 bbls gelled 10# brine, pmp 25 bbls acid & flush w/50 bbls 2% KCL-TFW. Rel pkr & RBP. PU & set pkr @ 5302'. Swab. POOH w/pkr & RBP. GIH w/2 7/8" OPSMA, SN & tubing. Set OPSMA @ 6330', SN @ 6298' & tubing anchor @ 5400'. GIH w/rods & pump. Place on production 3/29/88. Tested 9 BO & 219 BW.

18. I hereby certify that the foregoing is true and correct

SIGNED D. E. Finney
(Type name for signature or State office use)

TITLE Administrative Supervisor

DATE 4/19/88

APPROVAL OF
COMMISSIONERS OF APPROVAL, IF ANY:

TITLE

DATE

*See instructions on Reverse Side

SJS

19. If this person knowingly and willfully makes to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Blm-Cadwell (1)