

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30-025-03037 01037
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Mark Owen
8. Well No. 1
9. Pool name or Wildcat Tubb Oil & Gas (gas)
10. Elevation (Show whether DF, RKB, RT, GR, etc.) GL 3380' KB 3393'

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	
2. Name of Operator Marathon Oil Company	
3. Address of Operator P.O. Box 2490 Hobbs, NM 88240	
4. Well Location Unit Letter L : 1980 Feet From The South Line and 1980 Feet From The East Line Section 35 Township 21-S Range 37-E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) GL 3380' KB 3393'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OP'NS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Cement Squeeze Paddock Perfs ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7/8/98 MIRU PU. ND wellhead. NU BOPE. Rel pkr at 5864'. POOH w/tbg & pkr. Clean out to 6295'. RIH w/CIBP & pkr. Set CIBP 5299', pkr at 5284'. CIBP fell to 6200'. POOH w/pkr.
7/9 TIH w/2nd CIBP & pkr. Plug sheared at 6197'. POOH w/pkr. RIH w/RBP & pkr. Set RBP at 5755'. pkr at 5719'. Tested OK. Reset pkr at 4978'. Establish pump-in rate. Rel pkr, POOH. Dumped 3 sxs sand on RBP at 5755'.
7/10 RIH w/cmt retainer, set at 4977'. Circ hole clean. Pump 150 sxs cmt into interval 5065-5212'. POOH.
7/11 RIH, tag retainer at 4977'. DO retainer. DO to 5163'. Circ hole clean. Test sqzd perfs, OK. Clean sand off RBP. Rel RBP, POOH.
7/13 RIH w/DC's. DO 1st CIBP at 6193'. Tag 2nd CIBP at 6218'. DO from 6218-6228'.
7/17 Could not recover all of 2nd CIBP. Left at 6228'. RIH w/2 3/8" prod tbg. ND BOPE. NU wellhead.
7/18 Swab well. RD PU.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kelly Cook TITLE Records Processor DATE 7/29/98
TYPE OR PRINT NAME Kelly Cook TELEPHONE NO. 393-7106

(This space for State Use)

APPROVED BY ORIGINAL SIGNATURE TITLE DATE
CONDITIONS OF APPROVAL, IF ANY: