WC VER PROCEDURE MA. OWEN NO. 1 Lea County, New Mexico Page No. 2

- 16. RIH w/2-3/8" production string (long) with parallel tubing anchor. Set 5-1/2" packer at 5,900' with tubing anchor @ ±5,060'. RIH w/2-1/16" short string and sting into tubing anchor @ 5,060'.
- 17. RIH w/rods and insert pump to pump short string (Paddock).
- 18. ND BOPs and nipple up dual wellhead.
- 19. Swab if necessary (Tubb).
- 20. RD pulling unit.
- 21. Put Paddock on pump.