

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR <i>Conoco Inc</i>	8. FARM OR LEASE NAME <i>SEMU Burger &</i>
3. ADDRESS OF OPERATOR <i>P.O. Box 460 - Hobbs NM 88240</i>	9. WELL NO. <i>No. 21</i>
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface <i>660' FSH & 1980' FRL - Unit Letter O</i>	10. FIELD AND POOL, OR WILDCAT <i>NMFU / Blinney QD & Co Skages Drinkard</i>
14. PERMIT NO. <i>30-025-67816</i>	11. SEC., T., E., M., OR BLK. AND SURVEY OR AREA <i>19-20S-38E</i>
15. ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH <i>Lea</i>
	13. STATE <i>NM</i>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANS ☐
(Other) ☐	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
(Other) <i>Perf & Acid Trac</i> ☒	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

MIRU on 4/10/87. Kill well w/50 bbl 10[#] Brine. Survey from 6800'-6300'. G/H w/7" RBP, pks & 217, ts 2 7/8" Hg. Set RBP at 6754' (above Drinkard perf at 6761' & below bottom Blinney perf at 6100') Spot 5 bbl 15% HCL-NE-FE acid from 6748'-6620'. POOH w/Hg & pka. G/H w/4" select fire csg gun & perf Upper Drinkard w/1 jsPF at 6606'-6715' for total of 26 holes. Acidize Upper Drinkard (6606'-6715') w/52 bbls 15% HCL-NE-FE acid. Tag w/RA material Drop 3 7/8" ball sealers every 4 bbl acid. Swab well. Release RBP & POOH. G/H w/SOPMA, SN, 39, ts 2 7/8" Hg, 7" Hg anchor & 178, ts 2 7/8" Hg. Tag up solid at 6750'. POOH w/Hg. G/H w/5 1/2" impression block to 6750'. Kill well w/50 bbl 10[#] Brine. Land Hg anchor at 5509' w/14 pks tension & SN at 6895'. Place well on production.

18. I hereby certify that the foregoing is true and correct

SIGNED *Deanne D. Finney* TITLE *Administrative Supervisor* DATE *July 1, 1987*

FOR SUPERVISOR'S (Federal or State office use)

APPROVAL OF
COMMISSIONS OF APPROVAL, IF ANY:

TITLE

ACCEPTED FOR RECORD

DATE *SJS*
JUL 8 1987

*See instructions on Reverse Side

CARLSBAD, NEW MEXICO