

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN 7
(Other instr.
verse side)

LOCATE
8 ON RE

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	5. LEASE DESIGNATION AND SERIAL NO. <u>LC-C31671C</u>
2. NAME OF OPERATOR <u>Conoco Inc.</u>	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR <u>P.O. Box 460 - Hobbs, New Mexico 88240</u>	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) <u>At surface</u> <u>760' FSL & 1650' FICK - Unit Letter N</u>	8. FARM OR LEASE NAME <u>SEMI BLINDING</u>
14. PERMIT NO. <u>30-C25-26182</u>	9. WELL NO. <u>100</u>
15. ELEVATIONS (Show whether DF, RT, CR, etc.)	10. FIELD AND POOL, OR WILDCAT <u>Blinding Oil & Gas</u> <u>Wagon Town Oil</u>
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA <u>20-20S-3SE</u>
	12. COUNTY OR PARISH <u>Lea</u>
	13. STATE <u>NM</u>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

REPAIRING WELL
ALTERING CASING
ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Work started on 10/16/87. -MIRU. POC H w/ Tubb & Blinding rods & pump. Kill well w/ 100 lbs 9" Spline. POC H w/ Blinding Htg & 1 1/4" vent string. Kill well w/ 50 lbs 10" Spline. Release long string. POC H w/ 212, 15 2 3/8" Buttress Htg. C-11 H w/ 3" packer pickup, 4" grapple, 4-4 3/4" DC & 140 1/2 2 7/8" work string. Tag scale at 6050'. Trip up swirl & remove unit. Clean out scale to 6140'. Mill over pump packer at 6140'. Rig down over swirl. Pull pk up hole 80'. Pk hung. C-11 H w/ RBP, pk & 2 7/8" Htg. Set RBP at 6135' & test to 2000 psi. Set pk at 5720' & lead csq w/ 130 BTFW. Acidize Blinding pipe 5790'-6028' w/ 44 lbs 15% HCl-NF-FE acid, dropping 3 ball sealers every 4 lbs acid pumped. Flush w/ 46 BTFW. Set RBP at 6645' & pk at 6160'. Acidize Tubb pipe 6157'-6679' w/ 54 lbs 15% HCl-NF-FE acid, dropping 3 ball sealers every 3 lbs acid pumped. Flush w/ 54 BTFW. Reset pk at 5720'. Swab well. Kill well w/ 50 lbs 10" Spline. Rel pk & RBP POC H. Sand anchor at 5511' w/ 12 pt tension. SN at 6595'. Ran producing equipment

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE

Administrative Supervisor

DATE February 3, 1988

For Bureau or State office use

APPROVAL OF
COMMISSIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See instructions on Reverse Side