

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLI
(Other instructions
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Conoco Inc.	8. FARM OR LEASE NAME Lockhart B-1
3. ADDRESS OF OPERATOR P.O. Box 460 - Hobbs, New Mexico 88240	9. WELL NO. 5
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FSL & 1980' FRL — Unit Letter O SJS	10. FIELD AND POOL, OR WILDCAT Arrowhead Crude
14. PERMIT NO. 30-025-08726	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 1-22S-36E
15. ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH Lea
	13. STATE NM

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANS ☐
(Other) ☐	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☒
(Other) ☒ Cleanout & Acidize	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Work started on 6/26/87. MIRR. Tag for fill and tally out. Fluid at 3781', 8' fill. Run in hole w/bit, DC & workstring. Tag at 3739', 51' of fill. Drill out to 3790' using 5 bags of oyster shell. Establish circulation & cleanout. POOH. Run in hole with underreamer, DC & workstring to 3700'. Establish circulation. Pressure up to 1100 psi to open underreamer. Underreamed from 3700' - 3750' & 3750' - 3790'. Spot 3 bbls 15% HCL-NE-FE acid from 3700' - 3720'. POOH w/workstring, DC & underreamer. Run in hole w/workstring, SN & treating pki. Pressure test to 5000 psi. Set pki at 3613'. Load CSG & test to 500 psi. Acidize Arrowhead with 20 bbls 15% HCL-NE-FE acid, over flush w/25 bbls 2% KCL TFW. Surb well. POOH w/workstring, SN & pki. Set SN at 3668' & SOPMA at 3698'. Ramped down equipment & place well on test. Work Completed on 8/4/87.

18. I hereby certify that the foregoing is true and correct

SIGNED DF Finney

TITLE Administrative Supervisor

DATE March 29, 1988

(For space for approval or State office use)

APPROVAL BY
COMMENTS OF APPROVAL, IF ANY:

TITLE

DATE

*See instructions on Reverse Side

SJS

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

BLM-Carlbad (6) arco(2) amoco(2) Chevron(1) Fil.