

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	State ☒ Fee ☐
5. State Oil & Gas Lease No.	B-1534

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - I" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Conoco Inc.	8. Farm or Lease Name State J-2
3. Address of Operator P.O. Box 460 - Hobbs, New Mexico 88240	9. Well No. 9
4. Location of Well UNIT LETTER <u>G</u> , <u>1980</u> FEET FROM THE <u>north</u> LINE AND <u>1980</u> FEET FROM THE <u>east</u> LINE, SECTION <u>2</u> TOWNSHIP <u>22S</u> RANGE <u>36E</u> NMPM.	10. Field and Pool, or Wildcat Eumont Queen Gas
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

OTHER Squeeze Eumont & Return Graveling to Productivity ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

- MIRU.
- Release pkr at 3665' & P00H w/ Hbg & pkr.
- Run scraper to liner top at 3672'.
- Set RBP at 3665' test to 1000 psi. Dump 2 sxs sand on RBP. Pick up and set pkr at 3400'. Establish injection into Eumont perms w/ 9% brine at 3 BPM. Record rates & pressures. P00H.
- Set cement retainer at 3410'. Test annulus to 500 psi.
- Squeeze Eumont perms w/ 200 sxs class "C" cement w/ 2% CaCl₂, 4% KCl, 0.6% Halad-9. P00H.
- Drill out retainer & cement from 3410' - 3612'. Run bit to top of sand at approximately 3650'. P00H.
- Circulate sand off of RBP at 3665'. Retrieve RBP & P00H.
- Rotate into top of liner at 3672'. Run to TD at 3870'. Spot 2 bbls

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED DF FINNEY

TITLE Administrative Supervisor

DATE October 23, 1987

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT SUPERVISOR

APPROVED BY _____

TITLE _____

OCT 28 1987

CONDITIONS OF APPROVAL, IF ANY: _____

RECEIVED
OCT 27 1997
OCD
HOBBS OFFICE