## Form 3160-5 (June 1990)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

N.M	. OIL	CONS.	COMMISSION
P.Q.	BOX	1980	

HOBBS, NEW MEXICO 88240

Budget Bureau No. 1004-0135 Expires: March 31, 1993

5. Lease Designation and Serial No.
NMLC030132-A

6. If Indian, Allottee or Tribe Name

## SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals 7. If Unit or CA, Agreement Designation SUBMIT O 1. Type of Well X Oil Well Gas Other 8. Well Name and No. 2. Name of Operator TOM CLOSSON #8 SOUTHWEST ROYALTIES, INC. 9. API Well No. 3. Address and Telephone No. 30-025-08808 P.O. BOX 11390, MIDLAND, TX 79702 (915) 686-9927 10. Field and Pool, or Exploratory Area 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) JALMAT TANSILL YT SR 11. County or Parish, State Sec. 6, T-22S, R-36E Unit A 660' FNL & 990' FEL LEA COUNTY, NM CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA 12. TYPE OF SUBMISSION TYPE OF ACTION X Notice of Intent Abandonment Change of Plans Recompletion **New Construction** Plugging Back Non-Routine Fracturing Casing Repair Water Shut-Off Final Abandonment Notice Altering Casing Conversion to Injection Plug & Abandon Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\* P&A as follows (see attached schematics) 357 (1) ND WH, NU BOP (2) RU WL - Dump bail 20 cmt on CIBP @ 3313'. Set CIBP @ 3100'. Dump bail 20 cmt. (3) Spear casing and free point. Cut csg above TOC (+2900'). POH w/7" csg. (4) RIH w/tubing to + 3050'. Circ 9.0 ppg mud. (5) Spot 40 sxs class "C" plug from 2965'-2835' (across TOC & Top of stub). (6) Spot 50 sxs class "C" plug from 1660'-1540' (across 9-5/8" shoe) and tag. (7) Spot 35 sxs class "C" plug from 325'-225'. (8) Spot 10 sx surface plug - cut off casing. (9) Install marker as per BLM requirements. 111 14. I hereby certify that the foregoing Is true and correct Area Supervisor 8-21-95 Title (This space for Federal or State office use)

