

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. A-2614

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- 2. Name of Operator Atlantic Richfield Company 3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240 4. Location of Well UNIT LETTER L, 660 FEET FROM THE West LINE AND 1980 FEET FROM THE South LINE, SECTION 14 TOWNSHIP 22S RANGE 36E NMPM. 15. Elevation (Show whether DF, RT, GR, etc.) 3532' GR	7. Unit Agreement Name 8. Farm or Lease Name McDonald WN State 9. Well No. 1 10. Field and Pool, or Wildcat Jalmat Gas 12. County Lea
---	---

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 4350', PBD 3454'
13-3/8" OD 36# csg set @ 320' & cmt'd w/225 sx.
8-5/8" OD 32# csg set @ 390' & cmt'd w/500 sx.

Propose to plug and abandon as follows:

1. Kill well w/fresh wtr.
2. POH w/comp assy. Call NMOCC before plugging operations start.
3. Run 8-5/8" cmt retr on tbg & set @ 3060'. Cmt w/100 sx Class C cmt cont'g 10% salt. Load hole w/9# mud.
4. Cut off & rec 8-5/8" csg from free point.
5. Spot 40 sx cmt in and out 8-5/8" csg stub.
6. Spot 100 sx cmt plug across 13-3/8" csg shoe.
7. Spot 10 sk cmt plug @ surface, install regulation P&A marker, clean & level location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>[Signature]</u>	TITLE <u>Dist. Drlg. Supv.</u>	DATE <u>10/16/74</u>
APPROVED BY <u>[Signature]</u>	TITLE <u></u>	DATE <u>001 21 1974</u>
CONDITIONS OF APPROVAL, IF ANY:		