

South Eunice Unit #30

30-025-08971

Recommendation to Temp. Abandon

This well is currently inactive. It is recommended that the well be temporarily abandoned in order to evaluate possible up-hole potential.

1. POOH and tubing.
2. Make scraper run inside 5.5", 14# casing to 3522'.
3. Set Cast Iron Bridge Plug w/in 50' of top of liner @ 3472', spot 35' cmt on top of CIBP.
4. Circulate Casing with inhibited packer fluid.
5. Pressure test casing to 500# for 30 minutes. Give OCD 24 hrs notice prior to pressure test.