

**South Eunice Unit #3**

**30-025-08976**

**Recommendation to Temp. Abandon**

This well is currently inactive. It is recommended that the well be temporarily abandoned in order to evaluate possible up-hole potential.

1. POOH with rods and tubing.
2. Make scraper run inside 5.5", 15.5# casing to top perf of 3572'.
3. Set Cast Iron Bridge Plug w/in 50' of top perf @ 3522', spot 35' cmt on top of CIBP.
4. Circulate Casing with inhibited packer fluid.
5. Pressure test casing to 500# for 30 minutes. Give OCD 24 hrs notice prior to pressure test.