

**South Eunice Unit #13**

**30-025-08980**

**Recommendation to Temp. Abandon**

This well is currently inactive. It is recommended that the well be temporarily abandoned in order to evaluate possible up-hole potential.

1. POOH with rods and tubing.
2. Make scraper run inside 7", 24# casing to 3692'.
3. Set Cast Iron Bridge Plug w/in 50' of end of csg. @ 3642', spot 35' cmt on top of CIBP.
4. Circulate Casing with inhibited packer fluid.
5. Pressure test casing to 500# for 30 minutes. Give OCD 24 hrs notice prior to pressure test.