

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State ☐	Fee ☒
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-121) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER- ☐	7. Unit Agreement Name <u>South Eunice Unit</u>
2. Name of Operator <u>Conoco Inc.</u>	8. Form or Lease Name <u>South Eunice ut</u>
3. Address of Operator <u>P.O. Box 460 - Hobbs, New Mexico 88240</u>	9. Well No. <u>11</u>
4. Location of Well UNIT LETTER <u>H</u> , <u>1980</u> FEET FROM THE <u>north</u> LINE AND <u>330</u> FEET FROM THE <u>east</u> LINE, SECTION <u>21</u> TOWNSHIP <u>22S</u> RANGE <u>36E</u> NMPM.	10. Field and Pool, or Wildcat <u>Eunice 7 BRS Queen S</u>
15. Elevation (Show whether DF, RT, GR, etc.)	12. County <u>Lea</u>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER <u>Clean Out, Open Hdl & Pay & Acidize</u> ☒	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU. POOH w/ rods & pump. Tag for fill & tally out of hole.
 2. Clean out to 3836' & POOH.
 3. Run csg scraper to 3836' & POOH.
 4. Log from 3836' - 3500' & correlate to existing log. POOH.
 5. Perf from 3683 - 3718' w/ 4 1/2 spf for total of 68 shots. POOH.
 6. Set pke at 3600'. Acidize w/ 120 bbls 15% HCL-NE acid w/ 80 gals Checker Sol or equivalent inhibited for 24 hrs at 100°F and 600# graded rock salt mixed in 5 bbls gelled 9# brine in 3 equal stages. Flush w/ 80 bbls 9# brine. Swab back load.
 7. Release pke at 3600' & POOH.
 8. Land SN at 3800'. Run rods & pump. Place well on test.
- If you need further information, call Jay Vashler at 397-5866.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton TITLE Administrative Supervisor DATE August 15, 1988

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE AUG 18 '88

CONDITIONS OF APPROVAL, IF ANY: