

UNITED STATES N. M. DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME <i>South Eunice Unit</i>
2. NAME OF OPERATOR <i>Conoco Inc.</i>	8. FARM OR LEASE NAME <i>South Eunice Unit</i>
3. ADDRESS OF OPERATOR <i>P.O. Box 460 - Hobbs, New Mexico 88240</i>	9. WELL NO. <i>No. 21</i>
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface <i>1980' FSH & 330' FWH - Unit Letter L</i>	10. FIELD AND POOL, OR WILDCAT <i>MMFEE/Eunice 7 RVRS Queen, S</i>
14. PERMIT NO. <i>30-025-08994</i>	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA <i>22-22S-36E</i>
15. ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH <i>Lea</i>
	13. STATE <i>NM</i>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other) *Clean Out, Open Add'l Pay & Reinject*

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. MIRU, Kill well w/ 27. KCH TFW w/ 1 gal Adomall/1000 gals if necessary. Tag for fill and tally out of hole
2. Clean out to 3828. POCH.
3. Run csy scraper to 3828.
4. Perforate intervals 3652'-68' and 3677'-84' w/ 4 spf for total of 92 skts. POCH.
5. Set pkr at 3550'.
6. Acidize interval 3652'-3826' at 4-6 BPM w/ maximum surface treating pressure of 2000 psi w/ 120 bbls 15% HCL-HF acid w/ 80 gals and 600 lbs graded rock salt mixed in 5 bbls gelled w/ brine in 3 equal stages. Flush w/ 100 bbls 2% KCH TFW w/ 1 gal Adomall/1000 gals. Swab well.
7. Release pkr at 3550' & POCH.
8. Land SN at 3775' & run producing equipment & place on production. If you have any questions, please call Jay Vashler at 393-4141.

18. I hereby certify that the foregoing is true and correct

SIGNED

DE FINNEY

TITLE

Administrative Supervisor

DATE

March 4, 1988

This space for regional or State office use:

APPROVED

TITLE

DATE

3-18-88

CONDITIONS OF APPROVAL, IF ANY:

*See instructions on Reverse Side

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Bhm-Carlbad (6) ARPD (2) Amoco (2) Ch. ren/1) ZL.