

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name <i>South Eunice Unit</i>
2. Name of Operator <i>Conoco Inc.</i>	8. Farm or Lease Name <i>South Eunice Unit</i>
3. Address of Operator <i>P.O. Box 460 - Hobbs, New Mexico 88240</i>	9. Well No. <i>10</i>
4. Location of Well UNIT LETTER <i>E</i> , <i>1650</i> FEET FROM THE <i>north</i> LINE AND <i>380</i> FEET FROM THE <i>west</i> LINE, SECTION <i>22</i> TOWNSHIP <i>22S</i> RANGE <i>36E</i> N.M.P.M.	10. Field and Pool, or Wildcat <i>South Eunice 7 Pools</i>
15. Elevation (Show whether DF, RT, GR, etc.)	12. County <i>Lea</i>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☒ <i>Clean Out, Open Additional Pay & Activity</i>	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

1. MIRR
2. Clean out to 3850'.
3. Set retrievable bridge plugs at 3710'. Spot 2 bbls 15% HCL-NE-FE acid from 3710'-3630'. POOH.
4. Perf w/4 js pf at 3660'-78' & 3683'-94' for total of 96 shots. POOH
5. Set pki at 3560'.
6. Acidize perfs from 3660'-3808' w/50 bbls 15% HCL-FE acid w/50 gals Checker-Sol and 250 # graded rock salt mixed in 4 bbls gelled 9# brine. Flush w/80 bbls 2% KCL TFW w/1 gal Adomalt/1000 gals. Release pki & RBP. Set pki at 3700' & RBP at 3830'. Pump 80 bbls 15% HCL-FE acid w/84 gals Checker-Sol. Pump 400 # graded rock salt mixed in 6 bbls gelled 9# brine. Flush w/100 bbls 2% KCL TFW w/1 gal Adomalt/1000 gals. Release pki. Swab well. Release RBP & POOH. Land/Nat

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED *Eddie W. Seay* TITLE *Administrative Supervisor* DATE *October 2, 1987*

APPROVED BY *Eddie W. Seay* TITLE *Oil & Gas Inspector* DATE *OCT 7 1987*

CONDITIONS OF APPROVAL, IF ANY: