

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.R.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	7. Unit Agreement Name
2. Name of Operator SUN OIL COMPANY	8. Farm or Lease Name Peerless et al
3. Address of Operator P.O. BOX 1861, MIDLAND, TX 79702	9. Well No. 1
4. Location of well UNIT LETTER C 660 FEET FROM THE North LINE AND 1980 FEET FROM West 22 TOWNSHIP 22-S RANGE 36-E NMPM.	10. Field and Pool, or Wildcat Jalmat Yates
15. Elevation (Show whether DF, RT, GR, etc.) 3537 GR	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☒ Foam Frac & Acidize	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- KILL WELL W/MINIMUM VOLUME 5% KCL WTR IF NECESSARY.
- MIRU. UNSET L-30 PKR, TAG PBTD # 3498', POH & LAYDOWN TRG & PKR.
- RIH W/PERMALATCH PKR, OSTSD (OD-5.5", ID-1.791") W/TYPE "N" LANDING NIPPLE, ON 2-7/8" WS TO 3480.
- SPOT 7 BBL (294 GAL) OF 15% NEFEHCL FROM 3480' TO 3302'.
- POH to 3250' & REV CIRC 5 BBL 5% KCL DOWN BACKSIDE, SET PKR @ 3250', RIG UP.
- ACDZ PERFS 3350/3478 W/2000 GAL FOAM 50 QUALITY 15% NEFHCL IN 2 EQUAL STAGES.
- SWAB IF NECESSARY TO RECOVER LAW, EVALUATE FE.
- FRAC PERFS 3350/3478 IN 2 EQUAL STAGES W/40,000 GAL 70 QUALITY NITROGEN-KCL FOAM & 48,000# 20/40 SD.
- WELL SHOULD CLEAN UP BUT SWAB IF NECESSARY.
- RUN SINKER BAR ON SLICK-LINE AND CHECK FILL, CLEAN OUT IF NECESSARY.
- SET PLUG ON WL IN "N" PROFILE, UNLATCH FROM SEAL ASSEMBLY & POH W/WS&OS.
- RIH W/OS ON 2-3/8" REPLACEMENT PROD. STRING TO 30' ABOVE PKR, CIRC & LOAD BACKSIDE W/PKR FLUID - TRETO KW-79 (10 GAL/100 BW)
- LATCH ON TO SEAL ASSEMBLY W/OS, LD BOP & NU WELL HEAD, RETRIEVE PLUG ON WL; PRODUCE & TEST.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Leresa Bradley TITLE Accounting Assistant II DATE 3-10-81

APPROVED BY _____ TITLE _____ DATE MAR 12 1981

CONDITIONS OF APPROVAL, IF ANY: