

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Texaco Inc.	8. Farm or Lease Name LR Kershaw
3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240	9. Well No. 7
4. Location of Well UNIT LETTER <u>C</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>2310</u> FEET FROM THE <u>West</u> LINE, SECTION <u>13</u> TOWNSHIP <u>20S</u> RANGE <u>37E</u> NMPM.	10. Field and Pool, or Wildcat East Weir Blinebry
15. Elevation (Show whether DF, RT, GR, etc.) 3566' DF	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) MIRU. Attempt to pull rods and pump out of 2 1/16" tubing. Install BOP. TOH with tubing.
- 2) By wireline, set 2 7/8" CIBP in Blinebry string at 5600'. With dump bailer, spot 1 sack cement (33') on top of CIBP up to 5565'. Cut both strings of 2 7/8" casing with jet cutter above the cement top at 2310'.
- 3) TOH with both strings of 2 7/8" casing.
- 4) TIH with workstring. Spot 22 sacks of cement (100') on top of the 2 7/8" casing stubs at ± 2300'. Tag
- 5) Raise workstring to 1460' and spot 27 sacks of cement (100') at 1360'-1460'. + Tag
- 6) Raise workstring, circulate mud to surface, then raise to 50' and spot 16 sacks of cement at surface to 50'. TOH. ND BOP.
- 7) Install dry hole marker. RDP. Clean location.

ALL INFORMATION CONTAINED HEREIN IS UNCLASSIFIED
DATE 10/27/01 BY 1043
EXCEPT WHERE SHOWN OTHERWISE

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

397-3571

SIGNED Eddie W. Seay TITLE Hobbs Area Superintendent DATE Sept. 1, 1987

APPROVED BY Oil & Gas Inspector TITLE DATE SEP 4 1987

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

SEP 9 1961

OCD
GENERAL OFFICE