

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-20126000

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL  
WELL ☒

GAS  
WELL ☒

Triple Completion  
OTHER

2. Name of Operator

Texaco Inc.

3. Address of Operator

P. O. Box 3109 Midland, TX 79702

4. Well Location

Unit Letter D : 660 Feet From The North Line and 990 Feet From The West Line

Section 13

Township 20S

Range 37E

NMPM

Lea

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. "X" Blinbry "Y" Grayburg "Z" Eumont (Gas)

"X" CIBP @ 4050 W/30' cmt CIBP @ 3800 "Y" CIBP @ 3890 & 3800 "Z" CIBP @ 3720 CIGR. @ 3559

1. Notify OCD of intent to plug

2. MIRU NU BOP on "X" string

3. RIH tag CIBP @3800 circulate hole w/mud pressure test

4. Spot 10 sx cmt @ 3800 to 3400

5. POH to 2750 spot 10 sx cmt from 2750 to 2350 POH

6. NU on "Y" RIH to CIBP @ 3800 circulate hole w/mud pressure test

7. Spot 10 sx cmt from 3800 to 3400

8. POH to 2750 spot 10 sx cmt from 2750 to 2350 POH

9. NU on "Z" RIH w/ stinger for CIGR to 3559 circulate hole w/ mud pressure test string into CIGR establish injection rate sqz 25 sx cmt spot 10 sx cmt on top from 3559 to 3159

10. POH to 2750 spot 10 sx cmt from 2750 to 2350 POH

11. Cut & pull "Z" @ 2300

12. Cut & pull "Y" @ 2300

THE COMMISSION MUST BE NOTIFIED 24  
HOURS PRIOR TO THE BEGINNING OF  
PLUGGING OPERATIONS FOR THE C-103  
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

David W. Deax

TITLE

Petroleum Eng

DATE

2/19/98

TYPE OR PRINT NAME

David Deax

TELEPHONE NO 915 688-4492

(This space for State Use)  
ORIGINAL SIGNED BY CHRIS WILLIAMS  
DISTRICT I SUPERVISOR

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: