State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I P.O. Box 1980, Hobbs, NM 88240 OIL CONSERVATION DIVISION 2040 Pacheco St.					SION	WELL API NO.	
DISTRICT II		Santa Fe,		7505		30-025-204	95
P.O. Drawer DD, Artesia, NM 88210						sIndicate Type of	
<u>DISTRICT III</u> 1000 Rio Brazos Rd., Aztec, NM	87410					₀State Oil & Gas	STATE
						388170	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)						₁Lease Name or Unit Agreement Name L.R.Kershaw	
Type of Well: OIL G WELL W	AS 🗖					_	
2Name of Operator						₃Well No.	
Texaco E & P						9	
sAddress of Operator P.O.Box 3109 Midland, Texas						₃Pool name or Wildcat	
4Well Location						Monument Tubb	
Unit Letter <u>B</u> :	661 Feet	From The Sou	rth	Line and	1777	Feet From T	he <u>East</u> L
Section	13	Township T2	0S F	Range	R37E	NMPM	Lea Coun
		⊅Elevation (<i>Show wh</i>				TAINT IVI	Cum
¹¹ C	heck Appro	priate Box to Indic	ate Na	ture of Not	lice Re	nort or Othe	r Data
	OF INTEN						REPORT OF:
PERFORM REMEDIAL WORK		PLUG AND ABANDON		REMEDIAL W		П	ALTERING CASING
TEMPORARILY ABANDON		CHANGE PLANS		COMMENCE	RILLING O	PNS.	PLUG AND ANBANDONI
PULL OR ALTER CASING				CASING TEST	AND CEME	ENT JOB	
OTHER:				OTHER:		J	
12Describe Proposed or Complete	d Operations (Clea	arly state all pertinent details	s. and give	pertinent dates	includina es	timated data of star	ting one property
work) SEE RULE 1103. 8-05-98Notify OCD of int		·	. 0	,		arrated date of star	any proposeu
8-06-98MIRU, Lay down	rods and tubir	ngin Z string					
8-10-98Set CIBP @ 634 8-11-98Circulate Z string	0' in Z string	nd snot 10 sy alass C		@ C240!t.			
cement (a) 5624	+. mix and spo	t 10 sx class C cemen	t @ 529	1'			
8-12-98Mix and spot 10 : @ 6700' in Y str	sx class C cem ring	nent @ 4085', mix and	spot 10	sx class C ce	ement @ 3	3650', set CIBP	
8-25-98Spot 25 sx class 9-01-98Spot 10 sx class	C cement @ 6	6700'					
0-01-00Opol 10 SX Class	ssure test to 10	000#, held OK, casing	not free	_			
9-02-98Cut Y string, pres							
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class	C cement @ 2	2560', cut Y & Z string	@ 1465	ı			
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string	a, pick-up on Y	string, spot 80 sx cla	ss C. cen	ant MOC	ourfoco [DMO	
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class	g, pick-up on Y D', spot 60 sx c	′ string, spot 80 sx cla lass C cement @ 450	ss C cen	ant MOC	surface, F	RDMO	
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330	g, pick-up on Y D', spot 60 sx c	′ string, spot 80 sx cla lass C cement @ 450	ss C cen	ant MOC	surface, F	RDMO	
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330 9-09-98Cut off wellhead	g, pick-up on Y D', spot 60 sx c and install dry l	∕ string, spot 80 sx cla lass C cement @ 450 hole marker, clean loc	ss C cen ', spot 20 ation.	nent, WOC) sx @ 30' to	surface, F	RDMO	
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330 9-09-98Cut off wellhead	g, pick-up on Y D', spot 60 sx c and install dry l	∕ string, spot 80 sx cla lass C cement @ 450 hole marker, clean loc	ss C cen ', spot 20 ation. y knowledg	nent, WOC) sx @ 30' to e and belief.			
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330 9-09-98Cut off wellhead a linear the improvement of the string signature.	g, pick-up on Y D', spot 60 sx c and install dry l	string, spot 80 sx clar lass C cement @ 450 hole marker, clean loc d complete to the best of m	ss C cen ', spot 20 ation. y knowledg	nent, WOC Osx @ 30' to e and belief. Manager,		RDMO Prod. Ser.,P&A	DATE <u>09-14-98</u>
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330 9-09-98Cut off wellhead a light the imprimation of the string signature	g, pick-up on Y D', spot 60 sx c and install dry l	string, spot 80 sx clar lass C cement @ 450 hole marker, clean loc d complete to the best of m	ss C cen ', spot 20 ation. y knowledg	nent, WOC Osx @ 30' to e and belief. Manager,			DATE <u>09-14-98</u> TELEPHONE NO. (915) 683
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330 9-09-98Cut off wellhead a linear the improvement of the string signature.	g, pick-up on Y D', spot 60 sx c and install dry l	string, spot 80 sx clar lass C cement @ 450 hole marker, clean loc d complete to the best of m	ss C cen ', spot 20 ation. y knowledg	nent, WOC Osx @ 30' to e and belief. Manager,			TELEPHONE NO. (915) 683
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330 9-09-98Cut off wellhead a light the imprimation of the string signature	g, pick-up on Y D', spot 60 sx c and install dry l	string, spot 80 sx clar lass C cement @ 450 hole marker, clean loc d complete to the best of m	ss C cen ', spot 20 ation. y knowledg	nent, WOC Osx @ 30' to e and belief. Manager,			
9-02-98Cut Y string, pres 9-03-98Spot 10 sx class 9-04-98Lay down Z string 9-08-98Tag plug @ 1330 9-09-98Cut off wellhead a I hereby certify that the imprimation SIGNATURE TYPE OR PRINT NAME RUSS Lig. (This space for State Use)	g, pick-up on Y D', spot 60 sx c and install dry l on above is true an ht, Manager, D	string, spot 80 sx clar lass C cement @ 450 hole marker, clean loc d complete to the best of m	ss C cen ', spot 20 ation. y knowledg	nent, WOC Osx @ 30' to e and belief. Manager,			TELEPHONE NO. (915) 683 MAR 2 2 20