Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

75', 75.5', 76', 76.5', 77', 780.5', 82'. TIH 80.5', 81', 81.5', 82'. TIH 8395'. Acidize with 1416 gal 07/09/93: Set RBP at 8184'. Set packer a OK. Circulate and spot acid. 8112'-8118' (1 spf). CONTINUED ON Thereby certify that the information above in true and complete to the best of my knowledge and belief.	7 1/2% NEFE. Swab test. t 8120'. Test tools to 1500#. Held TOH with tubing. Perforate from
75', 75.5', 76', 76.5', 77', 80.5', 81', 81.5', 82'. TIH 8395'. Acidize with 1416 gal 07/09/93: Set RBP at 8184'. Set packer a OK. Circulate and spot acid. 8112'-8118' (1 spf). CONTINUED ON Thereby certify that the information above is true and complete to the best of my knowledge and belief.	7 1/2% NEFE. Swab test. It 8120'. Test tools to 1500#. Held TOH with tubing. Perforate from PAGE 2 Coduction Records Manager DATE 9/14/93
75', 75.5', 76', 76.5', 77', 780.5', 81', 81.5', 82'. TIH 8395'. Acidize with 1416 gal 07/09/93: Set RBP at 8184'. Set packer a 0K. Circulate and spot acid. 8112'-8118' (1 spf).	7 1/2% NEFE. Swab test. t 8120'. Test tools to 1500#. Held TOH with tubing. Perforate from
75', 75.5', 76', 76.5', 77', 780.5', 81', 81.5', 82'. TIH 8395'. Acidize with 1416 gal 07/09/93: Set RBP at 8184'. Set packer a OK. Circulate and spot acid.	7 1/2% NEFE. Swab test. t 8120'. Test tools to 1500#. Held
75', 75.5', 76', 76.5', 77', 7 80.5', 81', 81.5', 82'. TIH	
07/07/93: Circulate to spot 100 gal 7 1/ Perforate "K" zone with (17) .	42 holes as follows: 8474', 74.5', 77.5', 78', 78.5', 79', 79.5', 80',
07/06/93: MIRU pulling unit. TOH with repacker and RBP. Set RBP at 85	ods and tubing. TIH with 5 1/2* 17# 00'. Set packer at 8490'.
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give p work) SEE RULE 1103.	vertinent dates, including estimated date of starting any proposed
OTHER:	Perforate, Acidize, and Frac
	NG TEST AND CEMENT JOB
TEMPORARILY ABANDON CHANGE PLANS COM	MENCE DRILLING OPNS. PLUG AND ABANDONMENT
PERFORM REMEDIAL WORK PLUG AND ABANDON REME	EDIAL WORK X ALTERING CASING
11. Check Appropriate Box to Indicate Nature NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
(I) A service Poy to Indicate Nature	of Notice Penart or Other Data
Section 36 Township 22 South Range 3	32 East NMPM Lea County 3, RT, GR, etc.)
	Line and 1980 Feet From The West Line
P.O. Box 1030, Roswell, New Mexico 88202-1030 4. Well Location	South Red Tank Delaware
Strata Production Company 3. Address of Operator	#1 9 Bool name or Wildcat
2. Name of Operator	8. Well No.
1. Type of Well: Off. Well X Well OTHER	Shell State
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLL DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	JG BACK TO A 7. Lease Name or Unit Agreement Name
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410	6. State Oil & Gas Lease No. V-2512
	5. Indicate Type of Lease STATE X FEE
DISTRICT II Santa Fe, New Mexico 87504 P.O. Drawer DD, Artesia, NM 88210	30-025-20810
	VISION WELL API NO.

PECEIVED

SEP 21 1993

OFFICE