


POST OFFICE DRAWER 1030
ROSWELL, NM 88202-1030

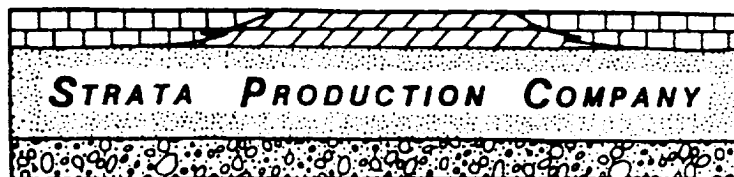

TELEPHONE (505) 622-1127
FACSIMILE (505) 623-3533

200 WEST FIRST STREET, ROSWELL PETROLEUM BUILDING, SUITE 700
ROSWELL, NEW MEXICO 88201

**ATTACHMENT TO FORM C-103
SUNDRY NOTICES AND REPORTS ON WELLS
LEASE NUMBER V-2512
SHELL STATE #1
SECTION 36-22S-32E
LEA COUNTY, NEW MEXICO**

- 07/10/93: Set packer at 7995'. Acidize with 34 bbls 7 1/2% NEFE. Swab test.
- 07/12/93: Swab well down. Frac via 2 7/8" tubing with 10700# 20/40 RC. Ramp sand 1 to 6 PPG. Ramp rate 4 to 7 BPM. Place 7900# 20/40 on formation. Swab test.
- 07/14/93: Release packer and TOH. TIH with hydro-static bailer. Tag sand at 8174'. Bail 10' sand off RBP at 8184'. Latch on to RBP. TOH with tools.
- 07/16/93: TIH with 5 1/2" Easy Drill CIBP. Set CIBP at 8800' above top Bone Spring perf. TIH with dump bailer. Place 20' cement on top of CIBP. TIH with RBP. Set RBP at 8090'. Displace with 2% KCL. Spot acid at 8052'. TOH with tubing. Perforate 11 holes at "G-3" zone 8038' to 8043'. Set packer at 7926'.
- 07/18/93: Acidize with 1500 gal 7 1/2% NEFE.
- 07/19/93: Set RBP at 7994'. Set packer at 7963'. Displace with 2% KCL. Test RBP to 500#. Held OK. Spot acid. TOH. Perforate 19 holes at "G-2" zone 7924'-7947'. Set packer at 7836'. Acidize with 1428 gal 7 1/2% NEFE.
- 07/20/93: Swab test. Release packer. Latch on to RBP. TOH with packer and RBP. TIH with production string. ND BOP. Set TA. Flange up tubing. Hook up well head.
- 07/21/93: TIH with rods and pump. Space well out. Hang well on. Start pumping unit. RD.
- Well placed on production.

RECEIVED

SEP 21 1993

**COB HODDS
OFFICE**